

Mackinac Co.

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

4 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>44</u> N. <u>X</u> , R. <u>11</u> W.	C-12, D-13, E-13
2. PROPERTY CONTROLLING IN SECTION	<u>32</u> , T. <u>44</u> N. <u>X</u> , R. <u>11</u> W.	<u>16-Sec. 32</u>
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. _____, R. _____ E. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, 6-13 & 5-31, 1979, established, the corner points mentioned in lines 1 and 2 above were, in a field survey on \_\_\_\_\_, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
 E-13, D-13, set by Wm A. Burt, D.S. in 1841. C-12 set by Wm Ives D.S. in 1849. Bearings were:

- C-12 1/4 Cor. bet. Sec's. 31-32, Fir 5", N34°W, 18 lks. & Cedar 6", N85°E, 11 lks.
  - D-13 1/4 Cor. on South side of Sec. 32, Tam 8", N32°E, 21 lks. & Tam 9", N85°W, 10 lks.
  - E-13 Sec. Cor. 32-33 on south Boundary of Twp., Hemlock 20", N32°E, 34 lks & Sugar 14", N45°E, 16 lks.
- 16-Sec.32 East 1/16 Corner on South side of Section 32.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- C-12 Placed Corner midway bet. two Sec. Cors. and in center of an old N-S railroad grade. Found no evidence of original corner.
- D-13 Placed corner midway and on line bet. two Sec. Cors. Found no original evidence.
- E-13 Placed corner in center of N-S road and by single prop. measure, North and South.
- 16-Sec.32 Placed corner on a straight line and midway bet. Sec. Cor. to East and 1/4 Cor. to West.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 Placed 1" pipe with 4" aluminium cap at all corners except C-12, Buried a 36" "T" Iron in road.  
 New Bearings are:

- C-12 6" Cedar, N30°E, 6.6' & 6" Cedar, S55°E, 7.7' & 5" Cedar, S58°W, 22.6'.
- D-13 6" Cedar, N88°W, 18.8' & 8" Cedar, N50°E, 29.4' & 6" Cedar, S67°E, 7.8'.
- E-13 20" Hemlock, S75°W, 61.1' & 8" Cedar, N72°W, 49.1' & 6" Cedar, S88°E, 54.4'.
- 16-Sec.32 8" Aspen, S79°W, 23.7' & 12" Aspen, N34°W, 27.3' & 12" Aspen, N67°E, 28.3'.

SIGNED BY Billy D. Buckler DATE 9-24-79  
 Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

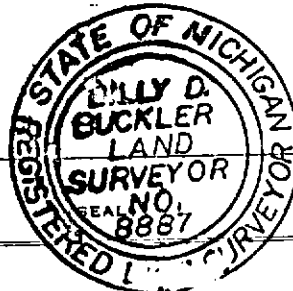

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
 CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
 MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_