

SURVEY & REMONUMENTATION

APR 29 1996

COMMISSION LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in


Macomb Located In: Erin/Lake Township Corner Code #G6
 (County)

1. Public Land Survey	T <u>1N</u> R <u>13E</u>	<u>G6</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Craig P. Amey, in a field survey on August 7, 1995 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

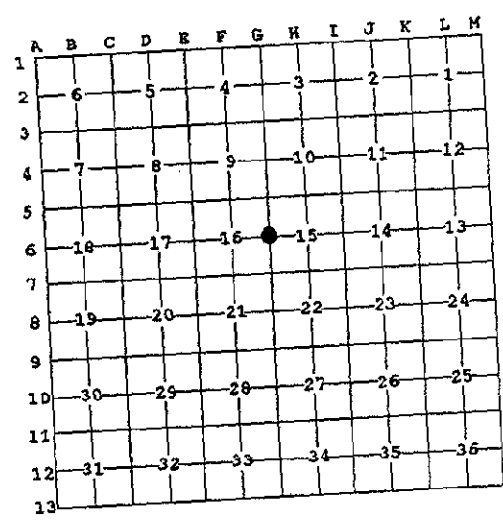

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1818 GLO
 1994 Cert. of Survey

William Preston
 Shelby W. Money #30092

No witnesses remain
 Found chiseled "x" in concrete and replaced with 1/2" iron and cap #17635

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found iron with cap #17635 in the centerline of 13 Mile Road (concrete)
 This corner verified by:

Witnesses from Cert. of Survey, Shelby W. Money
 30° 99.21 Southwest corner of a house
 315° 119.45 Southeast corner of a house

S 2697.24 Southeast corner of section 16 (G7) (GLO = 40ch)
 N 2688.21 Northeast corner of section 16 (G5) (GLO = 40ch)


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REPLACED IRON WITH 3/4" X 24" IRON WITH MCR CAP #34970 IN A NEW MONUMENT BOX

27°	65.35	Concrete monument
156°	38.61	Set PK and MCR tag in W face of a utility pole
222°	88.58	Chiseled "X" on the E side of a manhole rim
313°	74.01	Set PK and MCR tag in the SW face of a utility pole

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

ACCEPTED BY THE MACOMB COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 8-15-95
William E. Soderberg
 WILLIAM E. SODERBERG, P.S., CHAIRMAN

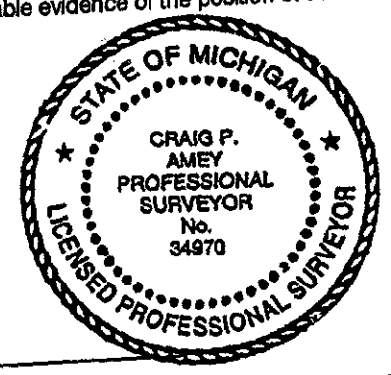

Signed by C. Amey Date 12-15-95
 Surveyor's Michigan License No. 34970

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983