

# SURVEY & REMONUMENTATION

C152266

APR 28 1995

## LAND CORNER RECORDATION CERTIFICATE

94 DEC 14 AM 10: 54

COMMISSION

Filing Requirement of Act 74, Mich. P.A. 1970

or corners in

MACOMB

(County)

Located In: Sterling Township Corner Code ##

Public Land Survey	T <u>2N</u>	R <u>12E</u>	<u>M-3</u>		
	T _____	R _____	_____	_____	_____
	T _____	R _____	_____	_____	_____
	T _____	R _____	_____	_____	_____
Property Controlling in Section	S _____	T _____	R _____	_____	_____
	S _____	T _____	R _____	_____	_____
Miscellaneous Property in Sec.	S _____	T _____	R _____	_____	_____
	S _____	T _____	R _____	_____	_____

LIBER 6527 PAGE 843

Register of Deeds Stamp & File Number

Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

Randy Kolehouse in a field survey on July 17, 19 94, hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A-3	Description of original monument and accessories and/or subsequent restoration:	Notes	Wampler	N/A	Post
	1817 G.L.O. Survey	L. 2314 P. 234	Avey	#15396	1" Pipe
	1972 L.C.R.C. Survey	L. 2377 P. 892	Kobs	#14097	3/4" Pipe
	1973 L.C.R.C. Survey	L. 2393 P. 593	Avendt	#16034	1" Pipe
	1973 L.C.R.C. Survey	L. 2464 P. 472	South	#20623	1" Pipe
	1976 L.C.R.C. Survey	L. 2761 P. 464	Avendt	#16034	1" Pipe in Box
	1979 L.C.R.C. Survey	L. 3184 P. 577	Fenn	#23505	1-1/2" Pipe in Box
	1979 L.C.R.C. Survey	L. 3197 P. 103	Soderberg	#17635	N/A
	1986 L.C.R.C. Survey	L. 4072 P. 317	Soderberg	#17635	Rebar with Cap
	1989 M.C.R.C. Survey	L. 4718 P. 1442	Money	#30092	2" Iron in Box
	1992 M.C.R.C. Survey	Hayes Rd. Pav. Proj.	N/A	N/A	N/A

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-3 Found 1/2" rebar in monument box center line intersection of Hayes Rd. & 19-Mile Rd.

L.C.R.C. L. 4718 P. 611 Top of Hyd. NE 79.11'	MCRC Hayes Rd. Repaving Prints Star Drill in Walk NE 137.33' Star Drill in Walk SW 138.80'
--	--

Measure N 2708.28 to M-2 (G.L.O. 2640)  
Measure S 2706.06 to M-4 (G.L.O. 2640)  
Measure E 2668.33 to B-3 T2N R13E (Survey L. 2393 P. 593 = 2668.15) (G.L.O. 2640)  
Measure W 2703.09 to L-3 (G.L.O. 2640)

This corner location is common with the A-3 T2N R13E.


Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-3 I replaced the found 1/2" Rebar with a 3/4" x 24" Iron Rod w/2" diameter aluminum cap stamped "Macomb County Monument MI Act 345 #25854" in an existing Monument Box.

Center Line Top Nut Fire.Hyd. N 70° E 79.08'  
Set PK with MCRC Tag SW Face Util. Pole S 46° E 81.13'  
PK SE Face Util. Pole S 47° W 69.38'  
Set PK with MCRC Tag NE Face Util. Pole N 37° W 87.21'

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Randy J Kolehouse Date 10/14/94  
Surveyor's Michigan License No. 25854

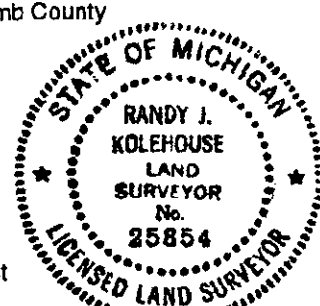

ACCEPTED BY THE MACOMB COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 8-30-94  
William E. Soderberg  
WILLIAM E. SODERBERG, P.S., CHAIRMAN