

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Macomb  
(County)

Located In:  
Shelby Twp.

Corner Code #

1. Public Land Survey	T	3N.	R	12E.	J-9
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S	T	R		
	S	T	R		
3. Miscellaneous Property in Sec.	S	T	R		
	S	T	R		

**SURVEY &  
REMONUMENTATION**

FEB 27 1997

**COMMISSION**

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Jeffrey A. Wright, in a field survey on June 20, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

ACCEPTED BY THE MACOMB COUNTY SURVEY PEER  
 GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN  
 PUBLIC ACT 345 OF 1990 AT A MEETING HELD  
 ON 7-27-96

*William E. Soderberg*  
 WILLIAM E. SODERBERG, P.S., CHAIRMAN

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

Date	Surveyor	Number	Type	L.	P.	Monument Box
1817	Wampler		Set Post	GLO Records		No
1939	Unknown		Unknown	Unrecorded		No
1978	Avey	15396	F. 1/2" Bar	Unrecorded		No
1980	Avey	15396	F. 1/2" Bar	3310	114	No
1981	Kobs	14097	F. 1/2" Bar	3355	492	No
1986	Avey	30076	F. 1/2" Bar	4080	886	Yes
1988	Avey	30076	F. 1/2" Bar	Unrecorded		Yes
1993	Avey	30076	F. 1/2" Bar	Unrecorded		Yes

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F. 1/2" Bar in existing monument box in centerline asphalt road


Fits call in:	Location supported by corners in:	J-9 - K-9 = 2648.70'	GLO Records
L. 3310, P. 114	F. 1/2" Bar Franklin Meadows Sub. L. 66, P. 38	J-9 - I-9 = 2625.85'	2640' / 40 chains
L. 3355, P. 492	F. 1/2" Bar		2640' / 40 chains
L. 4080, P. 886	F. 1/2" Bar		

C0438551 LIBER:07245 PAGE:412 08:59A 11/14/1996  
 CARMELLA SABAUGH-MACOMB COUNTY, MI REG/DEEDS

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced 1/2" Bar in existing monument box w/ 3/4" Bar w/ aluminum cap stamped "Macomb County Monument" M.A. Act 245 #40165

- AZ 246° 79.65' to Mag nail with remonumentation tag SE side U. Pole
- AZ 326° 82.67' to Mag nail with remonumentation tag NE side 10" Maple
- AZ 69° 67.92' to centerline Top hydrant
- AZ 357° 124.02' to Mag nail with remonumentation tag E. side 18" Maple
- AZ 109° 94.18' to Mag nail with remonumentation tag NE side U. Pole

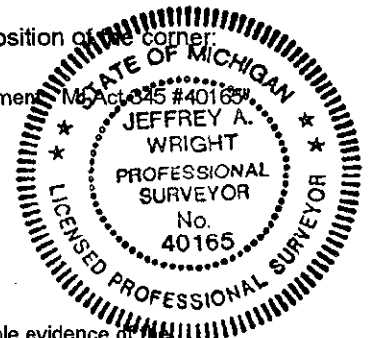

The selected location is accepted by me and is generally accepted by Professional Surveyors as the best available evidence of the position by the original corner.

Signed by *Jeffrey A. Wright* Date: 16 OCTOBER 1996

Surveyor's Michigan License No. 40165

576