

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Macomb</u>	Located In:	Corner Code #
(County)	<u>Ray Township</u>	
1. Public Land Survey	T 4N R 13E	<u>M3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

SURVEY &  
REMONUMENTATION

FEB 27 1997

COMMISSION

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

I, Craig P. Amey, in a field survey on June 15, 1996 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- 1817 William Preston Set post GLO
- 1972 Wm. Soderberg Set 3/4" rerod Melching and Assoc. witness card
- 1976 Robert Smith 16052 Found iron LCRC L2747 P594
- 1977 Herbert Kobs 14097 Found 1/2" pipe LCRC L2765 P542
- 1978 Herbert Kobs 14097 Found 1/2" pipe Cert of Survey L2958 P634

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" iron with cap #14097. Iron matched witnesses from LCRC L2765 P542, and LCRC L2747 P594. The iron is located approximately 100' south of 31 Mile Road in some brush along the northerly extension of a tree row.

North 2694.82 East quarter corner of section 1 (M2) 40 chains or 2640 GLO, 2692.31 prorated  
 South 2672.49 East quarter corner of section 12 (M4) 40 chains or 2640 GLO, 2684.42 prorated

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Replaced existing found iron with a 3/4" by 24" rebar with a 2" diameter aluminum cap stamped "Macomb County Monument MI ACT 345 M3 34970"

- 212° 17.35' Set PK and Macomb County Remonumentation tag in the E face of a 24" Apple
- 240° 81.70' Set PK and Macomb County Remonumentation tag in the SE face of a utility pole
- 286° 33.55' Set PK and Macomb County Remonumentation tag in the S face of a 7" Ash
- 22° 83.70' Set PK and Macomb County Remonumentation tag in the E face of a 36" Oak
- 0° 162.77' Set a 3/4" by 24" rebar with a 2" diameter aluminum cap

The selected location is accepted by me and is generally accepted by Professional Surveyors as the best available evidence of the position of the original corner.

ACCEPTED BY THE MACOMB COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 9-17-96

*William E. Soderberg*  
 WILLIAM E. SODERBERG, P.S., CHAIRMAN

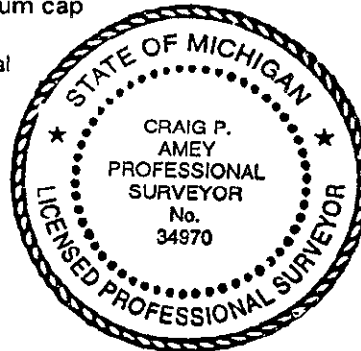

Signed by *C. Amey* Date November 30, 1996  
 Surveyor's Michigan License No. 34970

608