

SURVEY & REMONUMENTATION

APR 29 1996

C0283928 LIBER:06842 PAGE:99 01:43P 12/07/1995
 CARMELLA SABAUGH-MACOMB COUNTY, MI REG/DEEDS

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Macomb
 (County)

Located In: Bruce Twp. Corner Code # _____


- | | | | | | | |
|--------------------------------------|---|-----------|---|------------|-------------|-------|
| 1. Public Land Survey | T | <u>5N</u> | R | <u>12E</u> | <u>G-11</u> | |
| | T | _____ | R | _____ | _____ | |
| | T | _____ | R | _____ | _____ | |
| | T | _____ | R | _____ | _____ | |
| 2. Property Controlling in Section | S | _____ | T | _____ | R | _____ |
| | S | _____ | T | _____ | R | _____ |
| 3. Miscellaneous Property in Section | S | _____ | T | _____ | R | _____ |
| | S | _____ | T | _____ | R | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Huston K. Kennedy, in a field survey on November 10, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

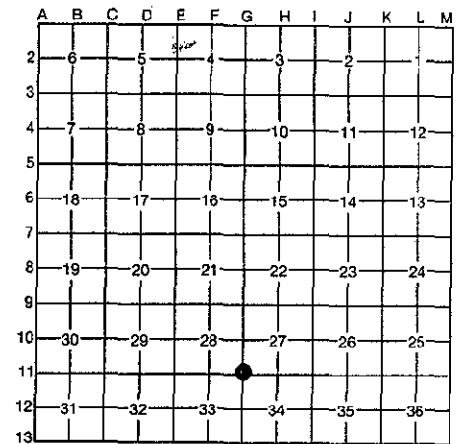

A. Description of original monument and accessories and/or subsequent restoration:

- 1817-GLO Wampler, D.S.; Set Post 22" White Oak N85°E 12 Links; 12" White Oak S11°E 19 Links
- 1.) 1972-Kobs, PS #14097; LCRC L.2332, Pg.291 - Fnd 3/4" Iron Pipe
 - 2.) 1979-Henderson, PS #16043; LCRC L.3115, Pg.584 - Fnd Iron Pipe
 - 3.) 1972-Kobs, PS #14097; Survey L.2334, Pg.261 - Fnd 3/4" Iron Pipe
 - 4.) 1974-Kobs, PS #14097; Survey L.2534, Pg.459 - Fnd 3/4" Iron Pipe, used same wit as Survey #3
 - 5.) 1976-Kobs, PS #14097; Survey L.2723, Pg.869 - Fnd 3/4" Iron Pipe, used same wit as Survey #3
 - 6.) 1976-Kobs, PS #14097; Survey L.2747, Pg.925 - Fnd 3/4" Iron Pipe, used same wit as Survey #3
 - 7.) 1979-Kobs, PS #14097; Survey L.3074, Pg.503 - Fnd 3/4" Iron Pipe, used same wit as Survey #3
 - 8.) 1979-Kobs, PS #14097; Survey L.3162, Pg.627 - Fnd 3/4" Iron Pipe, used same wit as Survey #3
 - 9.) 1980-Kobs, PS #14097; Survey L.3217, Pg.671 - Fnd 3/4" Iron Pipe, used same wit as Survey #3

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1995 Kennedy Surveying, Inc. - Kennedy, PS #17623 - Fnd 3/4" Iron Pipe 19 feet West of the centerline of Camp Ground Road, which has a gravel surface extending to the North & South, and 3 feet South of the centerline of 33 Mile Road, which has a gravel surface extending to the East & West.

Witnesses from LCRC #1 & 2 were used to recover and verify the location of the found 3/4" Iron Pipe.

FIELD MEASUREMENTS BETWEEN

- G-11 to G-10 2613.38 Ft. (m), GLO = 40 chains or 2640.00 Ft.
- G-11 to H-11 2673.43 Ft. (m), GLO = 40.40 chains or 2666.40 Ft.
- G-11 to H-11 2663.69 L.2747, Pg.925

ACCEPTED BY THE MACOMB COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 12-1-95

William E. Soderberg
 WILLIAM E. SODERBERG, P.S., CHAIRMAN

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- G-11 I replaced the found 3/4" Iron Pipe with a 3/4" x 24" Iron Rod w/2" diameter aluminum cap stamped "Macomb County Monument MI Act 345 #17623"
- N43°W 43.62' Set PK & Remon. Washer SW face Power Pole
 - N41°E 100.00' Set PK & Remon. Washer SE face 25" Maple
 - S72°E 41.85' Set PK & Remon. Washer SW face Power Pole
 - S36°W 59.85' Set PK & Remon. Washer NW face Guide Pole

The selected location is accepted by me and is generally accepted by Professional Surveyors as the best available evidence of the position of the original corner.

Signed by [Signature]
 Surveyor's Michigan License No. 17623

Date December 4, 1995

