

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 21 N. R. 15 W.	G-13; H-13; I-13
2. PROPERTY CONTROLLING IN SECTION 34	T. 21 N. R. 15 W.	11
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO.	RECORDED PLAT	
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 4, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

C. (continued)

11
Set 1"x3" pipe & cedar post
w/loc. tag
8" Oak N65°W 2.1
7" Oak S40°W 10.1

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-13 Found U.S.F.S. concrete mon. for Sec. corner common to Sec. 33 & 34 on S line of T. 21 N., R. 15 W.
- H-13 Found U.S.F.S. concrete monument for S $\frac{1}{4}$ corner of Sec. 34.
- I-13 Found U.S.F.S. conc. monument for sec. corner common to 34 & 35 on S line, T21N, R15W.
- 11 Established center of SW $\frac{1}{4}$ of Sec. 34, per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-13	H-13	I-13
Found F.S. concrete monument & 4"x4" post	Found F.S. conc. monument	Found F.S. concrete monument
3" R. Oak N76°W 44.34	7" Ash N88°E 63.19	9" W. Oak N69°W 10.66
5" W. Oak N27°W 27.23	S'ly edge LMR Due N 24'	9" & 9" Twn. Oak N88°W 106.16
NE Sec. 5, T20N, R15W	4"x7' Post Due N 1.3'	NE cor. garage S38°W 73.5
S88°E 115.84	N $\frac{1}{4}$ Sec. 4, T20N, R15W,	NE Sec. 4, T20N, R15W
	S88°E 143.78	Due E 137.20

SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

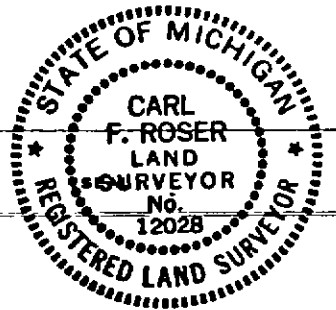

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ STRONACH TOWNSHIP
MANISTEE COUNTY