

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>21</u> N. <u>●</u> R. <u>16</u> W. <u>●</u>	E-8; F-8; H-8; I-8
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 30, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and for subsequent restoration:~~

C. (continued)

I-8
Set DNR mon. & cedar post
7" W. Pine N80°E 40.0
5" W. Pine Due S 9.5
3" W. Pine S45°W 34.1

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-8 Found 1½" pipe in old N-S fence that fits seven witnesses by & sec. 21 subdivision by R.L.S.'s K. Stephens and T. Slawinski.
- F-8 Railroad spike in N edge of b'top road that fits witness & Sec. 21 subdivision by K. Stephens and T. Slawinski.
- H-8 Established center of Sec. 22 at intersection of one-quarter lines.
- I-8 Reestablished E¼ corner Sec. 22 equidistant & on line between section corners N & S.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-8	F-8	H-8
Fd. & accepted 1½"x6' pipe & add cedar post w/loc. tag	Fd. & Accepted RR spike	Set 1½"x3' pipe & cedar post w/loc. tag
9" Tamarack N32°W 76.10	Power Pole N10°E 15.9	6" W. Pine S20°E 69.7
6" W. Birch N25°E 40.20	Guy Pole Due S 31.5	9" R. Pine S25°W 26.7
11" Cedar S70°E 24.16	⊥ E-W b'top road	8" R. Pine N75°W 18.1
	Due S 8.6	N. Rv. Rd. N01°43'E 363'±


SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

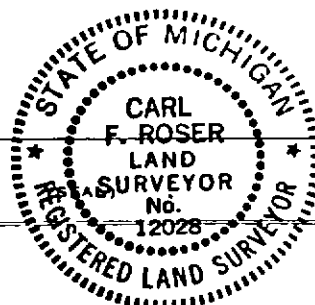

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____
STRONACH TOWNSHIP
MANISTEE COUNTY