

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>21</u> N. R. <u>16</u> W.	E-9; F-9; H-9; I-9
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 3, 19 , established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____ found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A--Description of original monument and accessories and/or subsequent restoration~~

C. (continued)

	I-9
Fd. & accepted	1" pipe in ctr. E-W grvl.rd.
24" B. Oak	N48°E 62.73
6" J. Pine	S15°W 79.48
Set ced.post w/loc. tag	Due N 33'
24" B. Oak	N56°W 73.16
Center dirt rd. to S	Due W 137'±

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

E-9 Found 3/4" bolt that fits witnesses & Sec. 21 survey data by R.L.S.'s W.D. Manchester (1932), K. Stephens, R. Griffin & T. Slawinski.

F-9 Found RR spike that fits Sec. 21 survey by K. Stephens & T. Slawinski.

H-9 Restored S 1/4 Sec. 22, equidistant & on line between SW & SE corners of Sec., which fits R.L.S. Ken Ross survey of Sec. 22.

I-9 Found 1" pipe that fits K. Ross witnesses.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-9	F-9	H-9
Fd. & accepted 3/4" bolt w/nut & 4"x4" treated pine post w/loc. tag	Fd. RR spike added 1 1/4"x22" iron pin buried in E-W gravel road	Set 1 1/4"x24" pipe in center E-W gravel road
6" W. Cherry N20°E 34.89	7" Oak N45°E 51.12	6" W. Pine S35°W 55.95
13" W. Oak N60°W 58.6	7" W. Pine S27°E 88.84	4" R. Pine S27°E 58.10
P. Pole S14°E 102.78	Set ced. post w/loc. tag Due N 33'	Set cedar post w/loc. tag Due N 33'
	Set ced. post w/loc. tag Due N 33'	
	Fd. pipes 33' N & 33' S	


SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

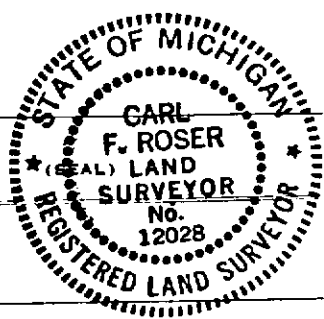

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ STRONACH TOWNSHIP
MANISTEE COUNTY