

SURVEY & REMONUMENTATION

APR 03 1996 LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

corners in Manistee (County)

Located In:

Corner Code #

Public Land Survey	T <u>21N</u> R <u>14W</u>	B-3
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
Miscellaneous Property In Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

REGISTER'S OFFICE
MANISTEE COUNTY

#95-281 AT 10:25 A.M.

JUL 20 1995

Penny A. Pease
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

Lot No. _____, Recorded Plat _____
Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3	7	8	9	10	11	12							
4													
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

BRUCE J JENEMA in a field survey on 12-15, 19 94,
 hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
 lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
 present manual of survey instructions of the United States Department of the Interior, Bureau of Land
 Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
 were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
 Court of Law; established, re-established, monumented, re-monumented, recovered, found as
 witnessed below:


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration:

Original Government surveyor Orange Riden 1848 Set 1/4 Post & Witnessed by:
 [1] White Pine 18" N33°W 58 links [2] White pine 18" S28°E 34 links
 [3] 1924 Theo Norland set pipe and witnessed [3] B. Oak 6" S62°E 27.0 ft.
 [4] B. Oak 9" N14½°E 10.0 ft. [5] NW cor. Sec. 7 is West 2793.4 ft This information is
 from Robert Griffin notes taken in 1979 when he located this corner and found
 witness No. [3] and [4] Took new witnesses [6] NW corner cabin S05°E 53.18 ft.
 Dodt corner N39°W 135.47±
 1986 A.M. Slawinski used Norland corner survey rec. Liber 1, page 888, 1986 Leemon

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Griffin used Norland corner, in Sept. 1960 Chas. Dodt by his survey established a
 second location for this corner N39°W 133.8 ft. The Dodt position for this corner
 has not been accepted by most local surveyors.
 Found 1" iron pipe
 and witness [3], [4] and [6] of Robert Griffin

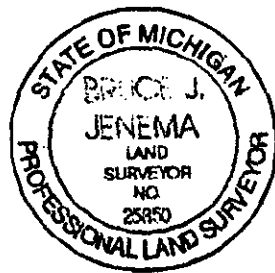

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

In 1994 replaced 1" iron pipe with 2"x30" stainless steel pipe and ID cap
 as careful and faithful reestablishment of this corner and witnessed by:
 N18°E 16" B. Oak 10.36 ft. [Norlin witness #4]
 S60°E 13" B. Oak 27.45 ft. [Norlin witness #3]
 S05°E NW cor. Cabin 53.18 ft. [Griffin witness #6]
 N90°W 12" B. Oak 7.20 ft.
 N39°W Dodt cor. 135.47 ft.

Corner B-03 ratified by the Manistee County Peer Group
 according to the county plan adopted pursuant to P.A. 345 of 1990,
 as amended, (being the State Survey and Remonument Act, MCL 54.261
 et seq.). Date of Peer Review: April 28, 1995

by Bruce J. Jenema
 Surveyor's Michigan License No. 25850

Date April 28, 1995 MAY 2 1995