

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	21N N. 14W E. T. _____ S., R. _____ W.	D3
2. PROPERTY CONTROLLING IN SECTION _____	N. E. T. _____ S., R. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	N. E. T. _____ S., R. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER'S OFFICE
MANISTEE COUNTY
 #93-215 AT 11:45 A.
APR 20 1993
Penny A. Pearis
 REGISTER OF DEEDS

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on January 23 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey or _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

<p>1/4 corner common to sections 5 and 8 of T21N R14W 1979 Survey by Robert A. Griffin Monu. Set 5" sq. by 60" long concrete monu. with 3" brass disk. Witnesses W.Oak 8 S40E 45.40' (OBT) W.Oak 5 S5E 61.07' W.Pine 1 N58W 73.2' Pine Post 3 East 1.3'</p>	<p>1971 Survey by D. House Monu. Fd. a 1 1/4" I.P. Witnesses W.Oak 7 S43E 45.36' W.Oak 7 S58W 44.51'</p>
---	--

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the monument and all the witnesses to be in good condition. The monument extends 1.4' above the surface. Liber 80 Page 24 documents the history of this corner as perpetuated by Griffin. I could find no evidence of the 1848 GLO post or witnesses. According to a 1978 survey by Lakestate Surveys this corner is very nearly an equal split between controlling corners, being N87-31-10W 2667.37' to the SW5 and S87-31-36E 2667.51' to the SE5. Ted Norlin worked in section 8 and C.Dodt followed him in 1958. Dodt was recovering Norlin's monuments and the 1/4 corner may have resulted from one of these two surveys. Lakestate distances match Norlin's to approximately 1'.

C. Description of monument for corner and accessories established to perpetuate locating the position of corner:

1/4 corner common to sections 5 and 8 of T21N R14W
 Monu. 5" sq. by 60" long concrete monu. with 3" brass disk.
 Witnesses
 W.Oak 12 S40E 45.40'
 W.Oak 8 S5E 61.07'
 W.Pine 3 N58W 73.09'
 Pine Post 3 East 1.3'
 Pipe Blade on south side of monument
 R.Maple 8 N10W 53.71
 Centerline of E-W 2-track is south 7'

SURVEY & REMONUMENTATION
 1993
COMMISSION

Corner 0-3 ratified by the Manistee County Peer Group pursuant to P.A. 123 of 1916, as amended by P.A. 345 of 1990, as amended. Date of Peer Review: FEB 1 1993


SIGNED BY Patrick R. Leemon DATE January 25, 1993

SURVEYOR'S MICHIGAN REGISTRATION NO. 31596

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

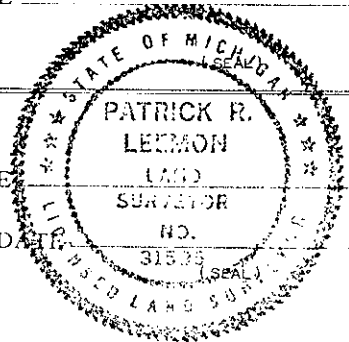

SURVEYOR'S MICHIGAN REGISTRATION NO. _____