

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	21N N. 14W E. T. S., R. W.	E3
2. PROPERTY CONTROLLING IN SECTION.....	N. E. T. S., R. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION.....	N. E. T. S., R. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER'S OFFICE
MANISTEE COUNTY
#93-214 AT 11 40A
APR 20 1993
Barney A. Leemon
REGISTER OF DEEDS

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on January 23 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

<p>Section Corner common to sec's. 4, 5, 8 and 9 of T21N R14W 1978 Survey by Robert A. Griffin Monu. Set 5" sq. by 60" long concrete monu. with 3" brass disk. Witnesses R. Pine 5 N18E 8.32' W. Pine 5 S70E 32.42' Tw. W. Oak 7 S9W 66.69' Pine Post 4 West 1.73'</p>	<p>1938 Survey by Ray Lyons Monu. Fd. Conc. monu. Witnesses USFS Post N10W 3lks. B. Oak 8 S40 1/4E 47'</p>
---	--

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the monument and all the witnesses to be in good condition. The monument extends 1' above the surface. Liber 79 Page 26 documents the history of this corner as perpetuated by Griffin. I could find no evidence of the 1847 GLO post or witnesses. The monument found by Lyons was probably set by Norlin in 1916. A 1971 survey by Slawinski verifies the Norlin distances.

C. Description of monument for corner and accessories established to perpetuate locating the position of corner:

Section Corner common to sec's. 4, 5, 8 and 9 of T21N R14W
Monu. 5" sq. by 60" long concrete monu. with 3" brass disk.
Witnesses
R. Pine 9 N18E 8.32'
W. Pine 10 S76E 32.42'
Tw. W. Oak 10x10 S9W 66.69'
Pine Post 4 West 1.73'
R. Pine 9 N60W 60.83
Centerline of an E-W 2-track is south 25'
The corner is North of the West edge of a W. Pine plantation in the SE quadrant.

**SURVEY &
REMONUMENTATION
1993
COMMISSION**

Corner E. M. ratified by the Manistee County Peer Group pursuant to P.A. 123 of 1916, as amended by P.A. 345 of 1990, as amended. Date of Peer Review: FEB 1 1993


SIGNED BY *Patrick R. Leemon* DATE January 25, 1993

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

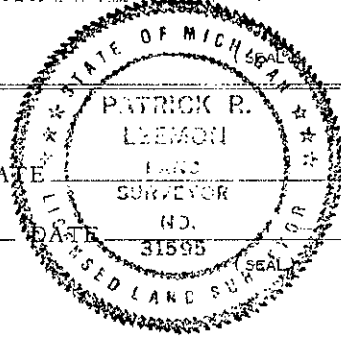

SURVEYOR'S MICHIGAN REGISTRATION NO.