

SURVEY & REMONUMENTATION

APR 03 1996

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Manistee COMMISSION
(County)

Located In: Corner Code #

REGISTER'S OFFICE
MANISTEE COUNTY

1. Public Land Survey T 22N R 14W M-9 of T22N R15W
A-9
- T _____ R _____
 T _____ R _____
 T _____ R _____
2. Property Controlling in Section S _____ T _____ R _____
 S _____ T _____ R _____
3. Miscellaneous Property in Sec. S _____ T _____ R _____
 S _____ T _____ R _____

FEB 2 1993

No. 93-41 AT 9:10 A.M.
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2						
3											
4	7	3	9	10	11						
5											
6	18	17	16	15	14						
7											
8	19	20	21	22	23						
9											
10	30	29	28	27	26						
11											
12	31	32	33	34	35						
13											

I, **Robert F. Mitchell**, in a field survey on May, 19 92, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

A-9: Southwest Corner Section 19; Originally established during U.S. Survey conducted by J. Brink in 1837 and monumented with a wood post witnessed by a Maple 10" S40°W 30 Lks. and a White Pine 15" N23°W 35 Lks. In 1902 H. Knight, Manistee County Surveyor found a stake point in agreement with both U.S. bearing trees and in 1909 Fargo Engineering found a stake in agreement with the White Pine U.S. bearing tree. Fargo Engineering documents state that the found stake was replaced with an iron pipe and lime.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-9; Southwest Corner Section 19; Found a 1½" by 30" iron pipe in a substantial lime deposit agreeing with both of Knights' witnesses of 1901 as recorded in Book "B", Page 120 of the Manistee County Surveyor Records and with one Fargo Engineering witness of 1909; namely, a Black Oak 8" S29½°W 0.49 Lks. which presently exists as a moderately decayed stump.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-9; Southwest Corner Section 19
Set a 2" x 30" Stainless Steel Pipe with 3" Brass Cap flush with the ground

- N34°E - 14" White Oak - 43.94'
- S59°E - 7" White Pine - 74.38'
- S30°W - 8" White Oak - 16.31'
- N14°W - 11" Red Oak - 15.87'
- East - carsonite post - 1.5'

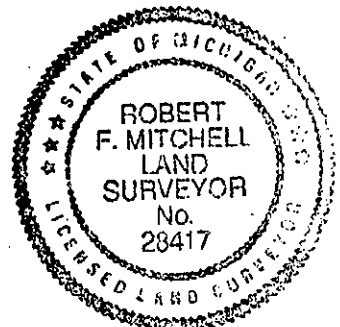

Corner M-9 ratified by the Manistee County Peer Group pursuant to P.A. 123 of 1990, as amended, by P.A. 345 of 1990, as amended. Date of Peer Review: JAN 4 1993

Signed by [Signature] Date 2/11/92
 Surveyor's Michigan License No. 28417