

DEC 1 1999

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

<u>Manistee</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 22N R 15W T 22NR 14W T ___ R ___ T ___ R ___	M-10 E 1/4 cor. Sec. 25 <u>A-10</u> ✓
2. Property Controlling In Section	S ___ T ___ R ___ S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec. _____	S ___ T ___ R ___ S ___ T ___ R ___	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

REGISTER'S OFFICE
MANISTEE COUNTY
 99-326 at 4:00pm
SEP 29 1999
Deborah Six
REGISTER OF DEEDS

Register of Deeds Stamp & File Number:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Bruce J. Jenema, in a field survey on April 29, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, reestablished, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-10 T22N R15W (E 1/4 corner of Section 25) Common to A-10 T22N, R14W

1837 J. Brink, D.S. GLO

Set post

1.) 11" W. Pine S60°W 6 links (3.96')

2.) 10" W. Pine N19 1/2°W 19 links (12.54')

1986 A.M. Slawinski

Unrecorded survey

Found iron rod

1909 Fargo Eng. Est midway & on-line between the NE & SE cor of Section

Rec. C.S. Book A, page 118 & 131

No U.S. evidence

3.) 6" W. Oak N79°E 1.12 1/2 ch. (74.25')


4.) 6" R. Oak N18 3/4°W 0.64 ch. (42.24')

1971 R. Griffin

Found spike @ intersection of Roads E-W & S

5.) 6" R. Pine N73°E 100.79' Spike & shiner

6.) 16" R. Pine S78°E 88.00'

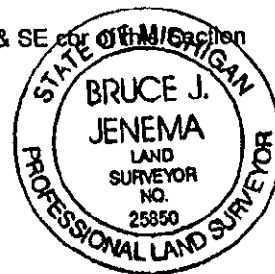

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On April 29, 1999, I found a 9" spike at the road surface and a 1 1/4" O.D. iron pipe 18" below surface with lime deposited by Fargo. No conflicting evidence of other corners existing.

Witnesses 1,2,3 & 4 are now extinct.

Found witnesses 5.) & 6.) in fair condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

On July 14, 1999, I placed a standard Manistee County Monument within a monument box at the exact position of the above 1 1/4" O.D. iron pipe and is accepted as the best available evidence of the position of the original corner and witnessed by:

5.) 6" R. Pine N73°E 100.79' Spike & shiner added 60-D spike S. side in same position as found nail & shiner

6.) 24" R. Pine S78°E 88.00' Set 60-D spike N. side 7.) 12" W. Oak S16°E 55.41' Set 60-D E. side

8.) 10" W. Oak S17°W 70.85' Set 60-D spike E. side

Signed by Bruce J. Jenema

Surveyor's Michigan License No. 25850

Date 9-16-99

ratified by the Manistee County Peer Group according to the county plan adopted pursuant to P.A. 345 of 1990, as amended, (being the State Survey and Remonument Act, MCL 54.261 et. seq.). Date of Peer Review: Sept 7, 1999
Anthony M. Slawinski