

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 22 N. R. 17 W.	L-10; L-11
2. PROPERTY CONTROLLING IN SECTION 25 _____	T. 22 N. R. 17 W.	9; 13
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on December 6, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or of subsequent restoration:

C. (continued) 13
 Set 1"x36" pipe & cedar post w/loc. tag
 10" Oak N86°W 29.2
 9" Oak S65°W 29.6
 11" Oak S16°E 19.0
 Fence corn. (Fn. N & E) S53°W 10.2

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- L-10 Established center of Sec. 25 on average line of monumentation, westerly from E¼ of Sec. 25 per survey by RLS T. Slawinski, of small parcels (KOTT PLAT - unrecorded) and at intersection of E-W ¼ line with N-S ¼ line as run north from S¼ of Sec. 25, parallel with the east line of SE¼ of Sec. 25.
- L-11 Found 1½" pipe; old accepted corner of record.
- 9 Established NE corner of NW¼ of SE¼ of Sec. 25, equidistant & on line between center and E¼ of Sec. 25.
- 13 Established corner per standard B.L.B. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-10	L-11	9
Set 1½"x36" pipe & cedar post w/loc. tag	Found 1½" pipe & set cedar post w/loc. tag	Set 1½"x36" pipe & cedar post w/loc. tag
T. Pole S83°W 74.64	4" R. Pine S53°E 18.3	6" Hemlock S02°E 22.5
P. Pole N20°E 80.94	6" W. Pine N60°W 32.1	7" Hemlock S81°W 12.7
Boat spike, ctr. M-110 N89°32'W 29.94	4" Maple (clstr.) S72°W 37.3	8" Hemlock N04°W 14.2
N'yly conc. light post N65°W 73.2	in grass field near E'ly edge of 8-12' Pine plantation	4" Sq. Conc. Mon. N89°32'W 33.91
		4" Sq. Conc. Mon. N89°32'W 100.07


SIGNED BY Carl F. Roser 2-20-75 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

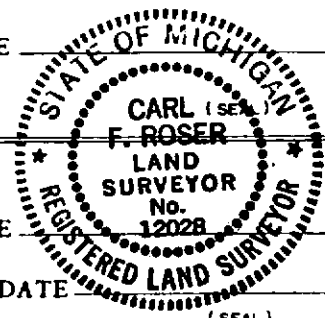

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ MANISTEE TOWNSHIP (N.P.)
 MANISTEE COUNTY