

DEC 10 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Manistee (County) Located In: Corner Code #
1. Public Land Survey T 22N R 15W M-04 E 1/4 cor. Sec. 12
T 22N R 14W A-04
2. Property Controlling in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R
4. Lot No. Recorded Plat
5. Private Claims

REGISTER'S OFFICE
MANISTEE COUNTY
99-329 at 4:15 pm
SEP 29 1999
Deborah Six
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

Grid table with columns A-M and rows 1-13. Contains numbers 1-36 in a grid pattern.

I, Bruce J. Jenema, in a field survey on April 27, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, reestablished, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-04 T22N R15W (E 1/4 corner of Section 12) Common to A-04 T22N, R14W

1837 J. Brink, D.S. GLO
Set Post

- 1.) 10" Beech S35°W 37 links (24.42')
2.) 11" Maple N28°W 18 links (11.88')

1996 D.E. Schripsema
Recorded L. 2 of Surveys pages 720
Found R.R. Spike centerline road
6.) P. Pole S10°E 163.36'
7.) T. Pole S19°W 89.27'
8.) 10" Cherry S58°W 37.47'
9.) Fence corner N86°E 30.34'

1897 J.H. Millard
Rec. C.S. Bk A, pg 106, 119 and Bk B, pg 34-35
3.) 30" Pine turnout S01°W 51 links (33.66')
4.) 30" Pine stump N43°E 76 1/2 links (50.49')
5.) 12" Maple N18°W 69 2/3 links (45.83') Bk A. pg 106

9/10/1992 A.M. Slawinski
Found R. R. spike
8.) 6" Black cherry S60°W 37.38'
10.) Fence post S35°E 50.68'
11.) 4" R. Pine N80°E 53.00'

Witnesses 1,2,3,4, & 5 are now extinct.
Witness 6,7,8,9,10 & 11 are in good condition.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On April 27, 1999, R.R. spike used for corner is missing, the following witnesses to locate corner.
No conflicting evidence of other corners existing. A fence is running to the East from this corner location.

- 6.) P. Pole S10°E 163.36' 7.) T. Pole S19°W 89.27'
8.) 10" Cherry S58°W 37.47' 9.) Fence corner N86°E 30.34'
10.) Fence post S35°E 50.68' 11.) 4" R. Pine N80°E 53.00'


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

On July 14, 1999, I placed a standard Manistee County Monument using the witnesses of record to relocate the position of this corner and is accepted as a careful and faithful reestablishment of the position of the original corner and witnessed by:

- 6.) P. Pole S10°E 163.36' Duplex E. side 7.) T. Pole S19°W 89.27' Duplex W. side
8.) 10" Cherry S58°W 37.47' Nail & watch gear S. side 9.) Fence cor. N86°E 30.34' Rec. (29.91' Measured) Duplex N. side
10.) Fence post S35°E 50.68' Nail & watch gear S. side 11.) 4" R. Pine N80°E 53.00' Nail & watch gear S. side

Signed by Bruce J. Jenema
Surveyor's Michigan License No. 25850

Date 9-16-99

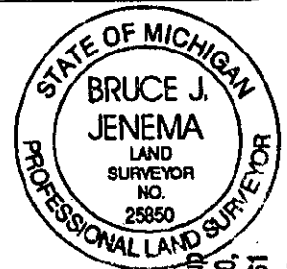

ratified by the Manistee County Peer Group according to the county plan adopted pursuant to P.A. 345 of 1990, as amended, (being the State Survey and Remonument Act, MCL 54.261 et. seq.). Date of Peer Review: [Signature] Sept 7, 1999