

REN

"K"

MAY 13 2000

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Manistee (County) Located In: Corner Code #
1. Public Land Survey T.22N R.15W M-13 SE Sec. 36
T.22N R.14W A-13
T.21N R.14W A-01
T.21N R.15W M-01
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R

REGISTER'S OFFICE
MANISTEE COUNTY
99-335 at 4:45pm
SEP 29 1999
Deborah Six
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

I, Bruce J. Jenema, in a field survey on August 31, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, reestablished, monumented, recovered, found as expressed below:

Grid table with columns A-M and rows 1-13. Contains numbers 1-36 in a grid pattern.

A. Description of original monument and accessories and/or subsequent restoration:

1837 J. Brink, D.S., G.L.O.
Set post
1.) Beech 13" N84°E 7 lks (7.66')
2.) Beech 11" N83 1/2°W 25 lks (16.50')


1907 J.H. Millard
Recorded C.S. Book A, pgs 38, 131 & 118
No U.S. Witnesses
3.) W. Pine Stump 18" N 1/1/2°E 18 lks (11.88')
4.) W. Pine Stump 16" S54 1/2°E 82 lks (54.12')
5.) Y. Pine stump 10" N77°W 24 lks (15.84')
1914 Fargo No Government witnesses
6.) Y. Pine stump 10" N30°W 24 1/2 lks (16.17')
7.) W. Pine stump 10" S54 1/2°E 82 lks (54.12')

1959 Charles Dodt
Unrecorded survey
Found Iron pipe
8.) Oak 20" S5°W 64'
9.) Oak 16" N20°E (Distance illegible)

1972 R.H. Kraft
Unrecorded survey Job. No. 220-71
Found 1" pipe
10.) 7" Tw. Maple NE 66.59'
11.) 9" W. Pine SE 66.93'
12.) 16" W. Oak SSW 52.10'

1980 G.A. Fauser Consumers Power Co.
Recorded Liber 1 of surveys page 809
Found pipe with brass cap
12.) 17" Oak S9°W 52.14'
13.) 7" Pine S18°E 60.75' found
14.) 8" Pine S40°W 56.00'
15.) 12" Oak S43°E 79.17'
USFS ID South 33.86'

1990 Ken L. Ross
Recorded Liber 2 of surveys page 176
Found U.S.F.S. Concrete monument

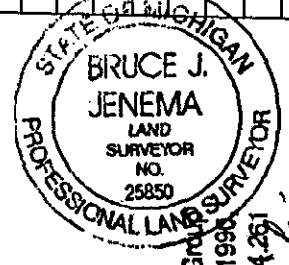

ratified by the Manistee County Peer Group pursuant to P.A. 345 of 1996 according to the county plan adopted pursuant to P.A. 345 of 1996 as amended, (being the State Survey and Remonument Act, MCL 54.261 et. seq.). Date of Peer Review: 9-16-99

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On Sept. 3, 1999, I found a standard US Forest Service concrete monument and brass cap. No conflicting evidence of other corners existing. Witnesses 1.) 2.) 3.) 4.) 5.) 6.) 7.) 8.) 9.) 10.) 14.) are extinct Witness # 11.) & 15.) no marks on tree Witness # 12 stump in poor condition Fd 60-D E. Side

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

On Sept 3, 1999, I found a 6" round concrete monument with a 3" brass cap stamped to identify the corner as a substantial marker for the corner and is also accepted as a careful and faithful reestablishment of the position of the original corner and witnessed by:
13.) 12" W. Pine S18°E 60.77' Fd. 80-D spike E. Side
16.) 8" W. Pine N60°E 65.45' Set 60-D spike W. side
17.) 4" concrete monument North 33.06' Ross ID cap
18.) 12" W. Pine S05°E Set 60-D E. side
19.) 18" W. Pine S50°E 58.35' Set 60-D E. side
20.) USFS ID post South 33.86' #16 nail E. side

Signed by Bruce J. Jenema
Surveyor's Michigan License No. 25850

Date 9-16-99