

DEC 11 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in SECTION

Manistee (County) Located In: Corner Code #
1. Public Land Survey T23N R15W M-10 E 1/4 cor. Sec. 25
T23N R14W A-10
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. , Recorded Plat
5. Private Claims

I, Bruce J. Jenema, in a field survey on April 27, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, reestablished, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-10 T23N, R15W (E 1/4 cor. Section 25) Common to A-10 T23N, R14W

- 1838 J. Brink, D.S., G.L.O
Set post
1.) 11" Beech S81°W 46 links (30.36")
2.) 11" Sugar N36°W 8 links (5.28')

- 1901 J.H. Millard, D.S.
Recorded C.S. Bk A, pg 222 & Bk B, pg 81
3.) School pump N57°W 124 lks (81.84')
4.) Cedar F.P. S2°W 38 lks (25.08')

1902 H. Knight, C.S.
Recorded in C.S. Book B, page 156-157

- 1906 J.J. Hubbell, Jr., C.S.
Rec in C.S. Bk A, pg 209 & Bk B, pg 206-207
Found old post by Knight
5.) SE cor School House N64°W 152 lks (100.32')
6.) 10" T. Pole S81°E 188 links (124.08')

DATE/SURVEYOR UNKNOWN

- Manistee Co. Road Commission corner records
7.) T. Pole NE 65.1'
8.) T. Pole NW 70.2'
9.) Fence Post S 35.35'

USGS BM button on 1" I.P.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

On April 25, 1999, I found a 1" iron pipe 8" below the road surface. Corner is in the center of East-West and North Road. No conflicting evidence of other corners existing.

- 1.), 2.), 3.), 4.), 5.), 6.), 7.), 8.), 9.) are now extinct
Note: Witness # 5, there is no evidence of Old school building, yard or fences.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

On July 14, 1999, I found a 1" iron pipe and placed a standard Manistee County Monument within a monument box at the exact position of said 1" iron pipe and is accepted as the best available evidence of the position of the original corner and witnessed by:


- 10.) N06°W P.Pole 184.31' Set 60-D East side
11.) N12°E Guy pole 189.70' Set 60-D W. side
12.) N50°E 10" R. Pine 95.65' Set 60-D E. side
13.) S30°W Face of Vent pipe for gas pipeline 31.50'
14.) N65°W 20" tw. Walnut 170.30' Center N. side No spike set
15.) N25°E 14" R. Pine 138.65 Set 60-D S. side

Signed by Bruce J. Jenema
Surveyor's Michigan License No. 25850

Date 9-16-99

REGISTER'S OFFICE
MANISTEE COUNTY
99-333 at 4:35 pm
SEP 29 1999
Deborah Six
REGISTER OF DEEDS

Register of Deeds Stamp & File Number
Table with columns A-M and rows 1-13. Cell 10-30 contains a dot.

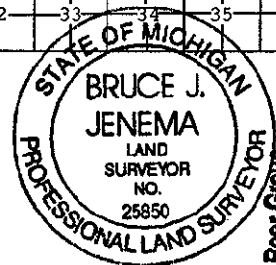

Corner M-10
ratified by the Manistee County Peer Group
according to the county plan adopted pursuant to P.A. 345 of 1990,
as amended, (being the State Survey and Remonument Act, MCL 54.261
et. seq.). Date of Peer Review: Anthony M. Shaw
Sept 7, 1999