

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

<u>Manistee</u> (County)	Located In:	Corner Code #
Public Land Survey	T 23NR 16W	Standard M-10 E 1/4 Sec. 25 <u>Standard</u>
	T ___ R ___	
	T ___ R ___	
	T ___ R ___	
Property Controlling in Section	S ___ T ___ R ___	
Miscellaneous Property in Sec.	S ___ T ___ R ___	

REGISTER'S OFFICE
MANISTEE COUNTY
 98-382 at 11:15AM
SEP 17 1998
Deborah Dix
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

Lot No. _____, Recorded Plat _____
 Private Claims _____

Bruce J. Jenema, in a field survey on July 30, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law; and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

9/13/1837 John Brink Set 1/4 post from which (1) Beech 11" S53°W 38 links
 (2) 8" Maple N57°W 38 links, now extinct
 Aug. 25, 1914 E.W.M. Set stone at intersection of Old fence post. Book "A", page 240
 A.M. Slawinski found chisel point on large rock with iron around it & witnessed by:
 (3) N35°W 46.74 ft. face of telephone junction box
 (4) S30°E 70.68 ft. 12" Pine
 (5) N45°E 48.58 ft. 10" Elm

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2"x24" iron bar, and stone 3.5' below grade.
 Witness (3), (4), (5) are now extinct.
 This corner has also been used as a property controlling corner for Section 30, T23N, R15W, occupation runs East from this corner and is located at the centerline intersection of Brandt which runs West and Milarch which runs South.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

On August 1, 1998, I placed a standard Manistee County Monument in a Monument Box in the exact position of the above 1/2"x24" iron bar and stone and is accepted as the best available evidence of the position of the original corner and witnessed by:
 (6) S85°E 42.59 ft. P. pole 60-D N. side
 (7) N20°E 39.90 ft. Face MBT Jct. box
 (8) N02°W 70.23 ft. 8" Cottonwood 60-D E. side
 (9) S48°E 85.65 ft. Tw. 8" & 12" R. Pine 60-D N. side
 (10) S00°19'E 1311.16 ft. Found pipe & P.K. for 1/4 corner (from which occupation fence line runs East & farm field runs West)
 (11) North 18.19 ft. W 1/4 cor. Section 30, T23N, R15W

Corner M-L O ratified by the Manistee County Peer Group according to the county plan adopted pursuant to P.A. 345 of 1990, as amended, (being the State Survey and Remonument Act, MCL 54.261 et. seq.). Date of Peer Review: Anthony M. Shewish
AUG 04 1998

Signed by Bruce J. Jenema
 Surveyor's Michigan License No. 25850

Date AUG 3 1998

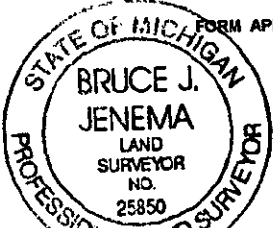

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 197
 REVISED MAY 14, 197
 REVISED JAN., 1983
 REVISED OCT., 1995