

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 24 N. R. 13 W. ●	K-4
2. PROPERTY CONTROLLING IN SECTION 12 _____	T. 24 N. R. 13 W. ●	5
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 23, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-4 Recovered 1/2" rod with RLS cap in approximate center N-S road and in line with fence remains E. Same corner position as recovered by RLS H.R. Bruning in 1968 and fits survey of Sec. 11 by H. Knight, 1902 and W.D. Manchester, 1929.

- 5 Reset 1" pipe that had been pulled & was lying on ground by found posthole, equidistant and on line between found center of Sec. 12 to S and found 1/4 corner to N. Irregular wire in trees and on ground; E-W 4'± N and to S is 12'± E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-4	5
Found 1/2" Rod	1"x30" pipe & cedar post
30" Maple N30°W 58.18	w/loc. tag
Power Pole S42°W 52.79	16" Maple S52°E 30.49
24" Twin Maple S08°E 132.65	7" Maple N66°E 40.09
2" Pipe Fn.Post N87°W 35.0	16" B.Cherry N06°W 28.10
Set cedar post w/loc. tag	8" Maple N70°W 15.75
Due E 33	


SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

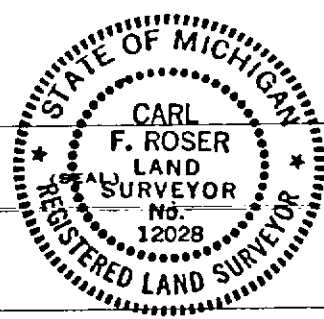

CLEON TOWNSHIP
MANISTEE COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET