

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

3

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. 24 N. 14 W. 0., R. 14 W.	C-9
2. PROPERTY CONTROLLING IN SECTION- 20	T. 24 N. 14 W. 0., R. 14 W.	8
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 2, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-9 Restored SW Corner of Sec. 20 by Double Proportion to U.S. (1839); per difference in Lat's. for 1/2 mile N. & 1-mile South and 1-mile to E & W. This method fits U.S. tie to Bear Creek near S 1/4 Sec. 20 & later tie to Bear Creek, probably J.H. Millard, 1900+. The small stream tie by U.S. near vicinity of S 1/4 Cor., Sec. 19, does not fit, but the stream bed is in swampy area & is highly irregular. Swamp edge tie to West does not make any sense either; it appears that U.S. may have had some seven chain error somewhere between Bear Creek & the West Twp. Line


8 Established NE Corner of NW 1/4-SW 1/4 of Sec. 20, equidistant and line between Ctr. of Sec. and W 1/4 Corner (see Cor. Rec. for W 1/4 Cor.).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p>C-9</p> <p>Set DNR Mon &amp; Ced. Post.</p> <p>4" Maple N20°E 22.0</p> <p>7" Cedar S10°E 17.2</p> <p>8" Maple S80°W 18.1</p> <p>"T" Rd. Inter. N-S-E</p> <p>(Fd. B.SpK.) S06°55'E 437.4</p> <p>Ctr. N-S B.Top</p> <p>County Rd. Due E. 61.6</p>	<p>8</p> <p>Drove 5/8"X40" re-rod &amp; Ced. Post w/Loc. Tag.</p> <p>10" W. Pine N80°E 32.0</p> <p>6" R.Maple S15°E 16.9</p>
--	--

SIGNED BY Carl F. Roser DATE 2-26-79

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

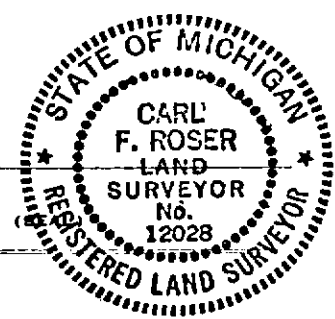

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

SPRINGDALE TOWNSHIP  
MANISTEE COUNTY

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET