

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>24</u> ^{N.} [●] , R. <u>14</u> ^{W.}	B-8; C-7; <u>E-7</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____, S., R. _____, E. _____, W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____, S., R. _____, E. _____, W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on October 12, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- B-8 Accepted real old corner fence post (for ctr. of Sec. 19), fence remains South with old fence to N.&E. This seems to fit survey of NE 1/4 of Sec. 19 by J.H. Millard, March 1897, Old County Surveyors Record Book A, Pg. 275.
- C-7 Fd. 1" pipe (buried 9") in approx. Rd. intersection, B.Top N-S-W, gravel to E. Corner fits 1/8 line fence 1/4 mile South & 1/4 line fence 1/2 mile to North reasonable. Believed to be same corner as used by co. Surveyor C.Dodt in 1951 and also recovered by Dept. Surveyor K. Ostling in 1961.
- E-7 Previous Dept. Mon. of Record;1961.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-8	C-7	E-7
Drove 1"X36" pipe w/plastic cap at fn. cor. & set ced.post w/Loc. Tag.	Fd. 1" pipe (buried 9") raised w/5/8"X14" re-rod w/RLS cap.	Fd. Dept. Mon.(buried). 16" Tw.Elm(dead)
4" Maple S52°W 40.3	18" Elm Stump N44°E 93.40	N34°E 83.41
8" Maple N08°W 44.8	17" W.Pine N10°W 142.30	10" Cherry (clump) S53°W 69.71
6" R.Pine S62°E 32.9	Telephone cable riser post N83°E 44.27	7" W.Pine S23°E 45.07
	Set Ced.Post w/Loc. Tag S45°E 48'	Set Ced.Post w/Loc.Tag Due N 40'
	Fd. 1" pipe(buried) in Rd. inter. N-S-W, poss.Rd.P.I. Due N+ 5.00'	Fd. 1 1/4 pipe(buried) S45°55'W 7.6'
		Conc. ROW Mon. Due N 32.93

SIGNED BY Carl F. Roser
2-26-79
 SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

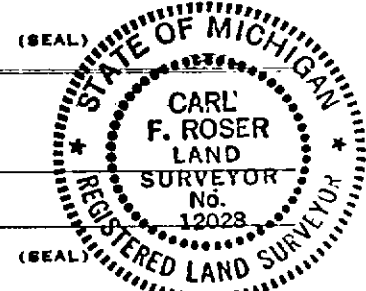

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

SPRINGDALE TOWNSHIP
 MANISTEE COUNTY