

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Manistee
(County)

Located In: _____ Corner Code =# _____

REGISTER'S OFFICE
MANISTEE COUNTY

95-396 AT 1:47 p.m.
OCT 09 1995

Penny A. Rogers
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

- | | | | | | |
|------------------------------------|---|------------|---|------------|----------------|
| 1. Public Land Survey | T | <u>24N</u> | R | <u>14W</u> | H-5 (S 1/4 10) |
| | T | _____ | R | _____ | _____ |
| | T | _____ | R | _____ | _____ |
| | T | _____ | R | _____ | _____ |
| 2. Property Controlling in Section | S | _____ | T | _____ | R |
| | S | _____ | T | _____ | R |
| 3. Miscellaneous Property in Sec. | S | _____ | T | _____ | R |
| | S | _____ | T | _____ | R |

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


I, Bruce J. Jenema, in a field survey on September 11, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 Corner common to Sections 10 & 15 Established by John Brink D.S. 8-11-1839
 Page 105 Government Book Set 1/4 post and witnessed by:
 B. Ash 14" N57°E 23 links Birch 6" S24°E 12 links [witnesses now extinct]
 Book B Page 198 and 199 Jan. 24, 1905 J.H. Mallard Found stake Birch BT,
 Cedar 12" N14°E 17 1/2 links, road running East-West

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 On Sept. 11, 1995 Found 3/4"x12" pipe at road surface, excavated 4.5' to natural ground and found 3/4"x12" pipe
 Nov. 1979 K. Ross Certificate of Survey recorded N 1/4 Section 15
 [1] 8" Cedar NW 57.35' [2] 8" Cedar NE 43.15' [3] 8" Maple SSE 35.30'
 LCRC #83-06 Carl F. Roser witnessed No [1] [2] and [3]
 MCRC witness 483 [1] [2] and [3], MCRC witnesses undated
 12" Elm SSW 51.3 12" Elm SE 64.4

Corner H-5 ratified by the Manistee County Peer Group according to the county plan adopted pursuant to P.A. 345 of 1990, as amended, (being the State Survey and Remonument Act, MCL 54.261 (1. sec.)). Date of Peer Review: October 3, 1995

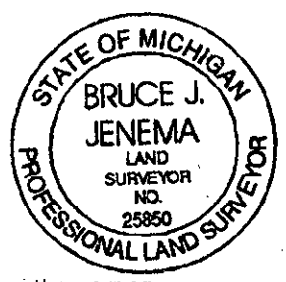

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 On September 11, 1995, Accepted 3/4"x12" pipe as a careful and faithful re-establishment of the position of the original corner and installed a 2"x30" stainless steel pipe with a brass ID cap enclosed within a monument box and witnessed by:
 [1] 8" Cedar N40°W 57.27' Found 60-D spike West side
 [2] 8" Cedar N40°E 43.03' Found 60-D Spike West side
 8" R. Maple S12°W 59.46' Set 60-D spike West side
 10" H. Maple S24°E 60.25' Set 60-D spike East side

Signed by Bruce J. Jenema Date September 29, 1995
 Surveyor's Michigan License No. 25850