

OCT 03 2000

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Manistee (County) Located In: Corner Code #
1. Public Land Survey T 24N R 14W M-03 SE Sec Corner Sec 1
2. Property Controlling in Section S T R SW Sec Cor Sec. 6
3. Miscellaneous Property in Sec. S T R
4. Lot No. , Recorded Plat
5. Private Claims

REGISTER'S OFFICE MANISTEE COUNTY

00-302 at 11:42 p.m. SEP 03 2000

Penny Cr. Pepera REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Anthony M. Slawinski, in a field survey on June 2, 20 00 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration: Southeast Section Corner Section 1 (24-14) & Southwest Section Corner Section 6 (24-13) Set by John Brink in 1837.

- 1. W. Ash 10" in dia. S 37° W 38 links (25.08')
2. Sugar 10" in dia. N 57° W 35 links (23.10')

- Copy of Minutes of Survey in 1907 by Millard book B, page 68
Fd. Decays of Stake and Bearing Tree stumps, Set Bottles.
3. Cedar Telephone Pole 10" in dia. S 40° E 54 links (35.64')
4. White Pine Stumps 36" in dia. S 85° E 74 links (48.84')

- Manistee County Surveyor's Record (undated) book A, page 264
Fd. 1/2" Iron Rod
5. Stump. 6" in dia. N 75° E 63.28'
8. Poplar 5" in dia. East 44.34'
9. Iron wood 10" in dia. S 80° E 56.85'
10. Iron wood 10" in dia. S 40° E 60.35'

- P.A. 74 Form by Larry M. Gerschbacher RLS #18990 in 1977.
Fd. 1/4" Re-bar. Rec. 79-1
5. Poplar 8" in dia. N 75° E 63.28'
6. Telephone Riser Post S 20° E 82.62'
7. N.E. corner "Chuckler" metal building, on metal corner S 55° W 93.32'

- Certificate of Survey by Anthony M. Slawinski in 1981.
Fd. Stake and Bearing Tree stumps & bottles
3. Cedar Telephone Pole 10" in dia. S 40° E 54 links (35.64')
4. White Pine stump 36" in dia. S 85° E 74 links (48.84')

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: Southeast Section Corner Section 1 (24-14) & Southwest Section Corner Section 6 (24-13) On June 2, 2000, I Anthony Slawinski, along with a field crew from the Abonmarche Group found 1/2"x24" iron rod over a 2" pipe (2" pipe +/- 39" deep). The crew found no other evidence to dispute this location for the corner.

Condition of witnesses: #1 gone, #2 gone, #3 gone, #4 gone, #5 gone, #6 gone, #7 good, #8 gone #9 good, #10 good

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: Southeast Section Corner Section 1 (24-14) & Southwest Section Corner Section 6 (24-13) On June 2, 2000, I placed a Manistee County Monument, over a the existing 2" pipe, in the exact location as the above mentioned 1/2"x24" iron rod as a careful and faithful perpetuation of the original corner, and witnessed


- 7. S 55° W 93.32' NE Corner Chuckler Metal Building
8. S 80° E 56.85' 12" Ironwood (fd. spike in N side of tree)
10. S 40° E 60.35' 12" Ironwood (fd. spike in N side of tree)
11. N 51° E 64.48' 9" Poplar (fd. spike in S. side of tree)
Corner is in the centerline, centerline intersection of Thompsonville Rd. and Vondra Rd.

Grid table with columns A-M and rows 1-13. Contains numbers 1-36 and a dot at row 3, column A.

Corner M - 0 3 ratified by the Manistee County Peer Group according to the county plan adopted pursuant to P.A. 345 of 1990, amended, (being the State Survey and Remonument Act, MCL 54.261 et seq.). Date of Peer Review: 7-31-00

Anthony M. Slawinski

M.D.O.T. R/W Map No iron stated, no witnesses undated

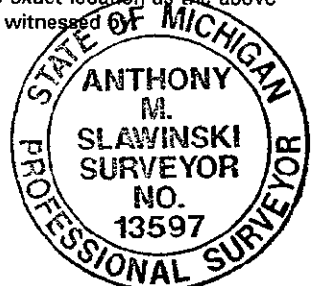

Signed by Anthony M. Slawinski Surveyor's Michigan License No. 13597

Date 7-26-00