

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 24 N. R. 15 W. ●	L-5; L-6; L-7
2. PROPERTY CONTROLLING IN SECTION 13 _____	T. 24 N. R. 15 W. ●	12
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 23, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~For description of monumentation see separate recordation~~  
 C. (continued)

- 12
- Set 1"x36" Pipe & cedar post w/loc. tag
  - 22" Hemlock S10°W 37.10
  - 10" Maple N08°W 21.37
  - 7" Maple N76°W 12.22

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- L-5 Found 1" pipe that fits J. H. Millard survey of 1907.
- L-6 Accepted large stone at fence intersection N-S-E which fits Millard tie to old railroad grade and his split-up of Sec. 13 in 1907; see large red co. surveyor's book, p. 288, at Register of Deeds.
- L-7 Reestablished corner equidistant & on line between sec. corners to E & W as established by Millard in 1907; see large red co. surveyor's book, p. 288, at Register of Deeds.
- 12 Established corner equidistant & on line between center of Sec. 13 to N and ¼ corner to S. Corner is 3' W and 60' N of corner fence post (fence N & E).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-5	L-6	L-7
Found 1" pipe & 1" hexagonal bar; set ced. post w/loc.tag	Set 1½"x36" pipe & post w/loc. tag	Set DNR mon. & cedar post
20" Maple N87°W 15.43	16" Tri-B. Cherry N27°E 60.45	6" Tw. Hemlock N64°E 21.9
9" Maple N19°E 24.38	Ctr. old RR grade Dug N 6'	7" Maple S26°E 44.4
7" Maple S72°E 24.28	30" Black Cherry S08°W 41.57	11" Cherry S47°W 24.7
	8" W. Pine S43°E 54.30	
	Ctr. B'top County Road	
	Due S 108.3	


SIGNED BY Carl F. Roser 9-4-75 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

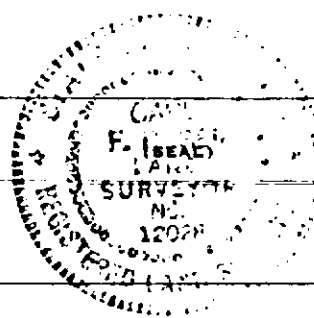

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ PLEASANTON TOWNSHIP  
 MANISTEE COUNTY