

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 24 ^{N.} R. 15 ^{W.}	I-8; I-9; K-8; K-9
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION <u>26</u>	T. <u>24</u> ^{N.} R. <u>15</u> ^{W.} & 646.48 E of J-9 & 1939.45 W of K-9.	XX = on line between
4. LOT NO. _____	RECORDED PLAT _____	_____
5. PRIVATE CLAIMS _____	_____	_____

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 2, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on May 23, 1975, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and of subsequent restoration:~~

C. (continued)

	K-9		XX	
Set DNR mon. & cedar post w/loc. tag				Set 1"x36" pipe & ced. post w/loc. tag
18" B. Cherry S10°E 62.33				6" Maple S45°W 57.20
Corner Fn. Post S45°W 41.5				8" Cherry S82°E 50.63
6" R. Pine N49°E 45.57				6" R. Pine N16°E 51.69
20" B. Cherry N78°W 120.58				Corner fence post (down, fn. S&E)
				S02°E 38'±
				Irreg. E-W Sand trl. N 39'±

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-8 Found two 1" pipes (buried) from two Millard witnesses, dated Dec. 1907. Irregular two-track N & S is approximately 7' West.
- I-9 Recovered 1" pipe that fits Millard survey of Sec. 23.
- K-8 Recovered iron, surrounded by stones, in E-W fence remains, old corner fence post 34' W. Corner fits Millard split-up of Sec. 23 in 1907; see large red co. surveyor's book, page 289, at Register of Deeds.
- K-9 Recovered iron, surrounded by stones, per Millard survey of Sec. 23 in 1907.
- XX Set 1"x36" pipe for NE corner of W $\frac{1}{2}$ -W $\frac{1}{2}$ -NE $\frac{1}{4}$ of Sec. 26. Corner established per standard B.L.M. instructions.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-8	I-9	K-8
Found 1" pipe & added DNR mon. w/cedar post	Found 1" Pipe; set cedar post w/loc. tag	Set DNR monument & cedar post
28" Maple S34°E 29.70	22" Maple S57°W 41.66	6" Maple S45°W 3.06
24" Maple N87°E 27.10	7" Maple S36°E 35.30	12" B. Cherry N30°W 37.50
12" Maple N77°E 46.8	8" Maple N36°E 36.17	9" Maple N44°E 15.05
11" Beech S55°E 84.4	Center E-W Dirt Trail	7" B. Cherry S31°E 14.40
Corner fence post (down-fence W&S) Due E 39'	Due N 6.5'	
N-S Random Due W 3.1'		

SIGNED BY Carl F. Roser 9-4-75 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

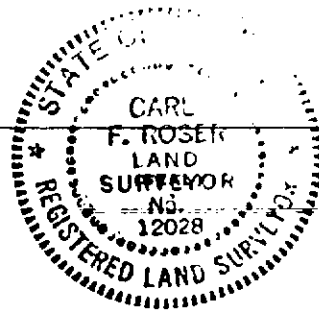

SURVEYOR'S MICHIGAN REGISTRATION NO _____

PLEASANTON TOWNSHIP
MANISTEE COUNTY