

1993

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

For corners in

MANISTEE
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|---------------------------|-----------------|
| 1. Public Land Survey | T <u>24N</u> R <u>16W</u> | <u>K-4, K-5</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

REGISTER'S OFFICE
MANISTEE COUNTY

93 581 AT 11:35 A.M.

OCT 6 1993

Penny A. Peore
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Sammy S. Barnett, in a field survey on July, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-4 1/4 corner, Sections 11 & 12

Black Ash, 18", used for cor., by John Brink in 1839 subdivision survey.

K-5

Section Corner, Sec's. 11, 12, 13 & 14.

Hemlock, 36", used for cor., by John Brink in 1839 subdivision survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-4 1/4 corner, Sections 11 & 12

Found 1" iron pipe set by Millard in 1901.

NOTE: Millard found Cooks B.T. set iron and stone.

S 57° W 251ks. (16.50') 10" Sugar Maple

N 46° E 331ks. (21.78') 20" Birch

S 30° E 651ks. (42.90') 24" Birch

NOTE: Corner recovered by Bruce Jenema (P.S. #25850) in 1989. N 55° W 44.00' 8" Cherry
West 33.00' Conc. mon., N 55° E 33.80' 6" B. Ash.

K-5

Section Corner, Sec., 11, 12, 13 & 14.

Fence corners East & West

Found rail road spike, used for corner by, Barnett & Hays in 1906.

N 54° W 36.78' Fence post

N 24° E 116.15' Fence post

S 16° E 146.42' Gate post

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-4 1/4 corner, Sections 11 & 12

Found 1" iron pipe and replaced with Manistee County remon. monument, and is accepted as a careful and faithful perpetuation of the position of the original corner.

N 55° E 33.80' 10" Black Ash

S 48° E 31.18' 5" Poplar

S 70° W 36.27' 8" Cherry

N 54° W 44.00' 12" Cherry

K-5

Section Corner, Sec's., 11, 12, 13 & 14.


Found rail road spike and replaced with Manistee County remon. monument, and is accepted as the best available evidence of the position of the original corner.

N 65° W 207.10' 8" Black Ash

N 21° W 328.13' Power Pole

S 21° W 106.00' Cherry 9"

S 28° E 109.65' Poplar 8"

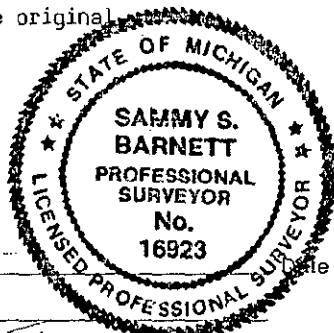

Signed by Sammy S. Barnett

Surveyor's Michigan License No. 16923

File 7130193

Corner K-5 ratified by the Manistee County Peer Group pursuant to P.A. 123 of 1915, as amended by P.A. 345 of 1990, as amended. Date of Peer Review: Aug 2, 1993

ratified by the Manistee County Peer Group pursuant to P.A. 123 of 1915, as amended by P.A. 345 of 1990, as amended.