

**SURVEY &  
REMONUMENTATION**


SEP 30 1993

**LAND CORNER RECORDATION CERTIFICATE**

COMMISSION

**FILING REQUIREMENT OF ACT 74, MICH. P.A.1970**

<b>FOR CORNERS OF --:</b>	<b>LOCATED IN --:</b>	<b>CORNER CODE NUMBER</b>
1. PUBLIC LAND SURVEY _____	T. <u>17N</u> N. <u>15W</u> E. _____ S., R. _____ W.	H3
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. _____ E. _____ S., R. _____ W.	
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ E. _____ S., R. _____ W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

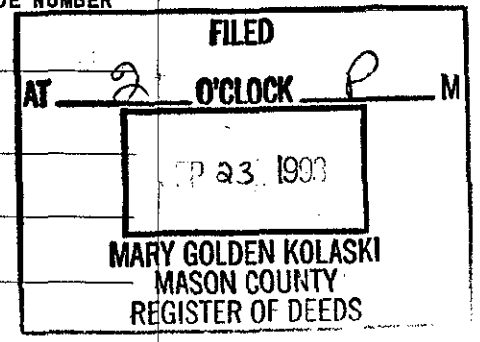

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on August 23 1993, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

**1/4 corner common to sections 3 and 10 of T17N R15W**

1838 survey by John Hodgson  
Set Wood Post  
Pine 12 S9W 20 links  
Pine 10 S8E 34 links

1935 field notes of John Cruger(USFS)  
Indicates the corner is in the E-W rd.  
and a Fn. line to south is west of cor.

1991 survey by Ken Ross  
Fd. conc. monu. by Griffin  
NE 10 S89-16-04E 2640.35 feet  
NW 10 S89-43-03W 2642.68 feet  
Recorded Liber 412 Page 176

1972 survey by Robert A. Griffin  
Fd. a 1/4"x1"x24" iron (very old)  
replaced w/ a 5" sq.x 36" long  
conc. monu. w/brass cap.  
W.Oak 5 S22W 95.08 feet  
W.Pine 3 N42W 76.92 feet  
B.Oak 7 N5W 77.97 feet  
P.Post 4"x7" North 33.35 feet  
NE 10 S89-50-25E 2642.55 feet  
NW 10 S89-41-35W 2640.43 feet

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

I found the 5" square by 36" long concrete monument w/ brass cap by Griffin rising 6" beneath the surface in a monument box and 1 foot north of the centerline of the E-W pavement. Liber 1 Page 218 by Griffin documents the history of this corner. The centerline of a 2-track to the north is east 22 feet and a fence line to the south is west 83.5 feet from the corner. This monument is accepted as a careful and faithful perpetuation of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**1/4 corner common to sections 3 and 10 of T17N R15W**

Monu. 5" sq. by 36" long concrete monu. with 3" brass disk was left in place.

**Witnesses:**

W.Pine 7 N41W 77.03'  
P.Post 4"x7' North 33.49'  
W.Oak 12 N46E 83.83'  
W.Oak 7 S10E 89.88'  
W.Oak 8 S19W 94.94'

Peer Group Reviewed  
and Approved  
Date: 9-16-93  
Kenneth L. Ross  
Mason County Surveyor


SIGNED BY Patrick R. Leemon DATE September 9, 1993

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

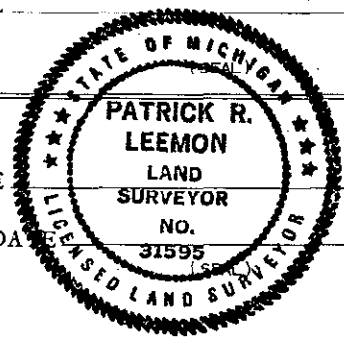

**LIBER 3 PAGE 110**

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_