


# SURVEY & REMONUMENTATION

SEP 30 1993

COMMISSION

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

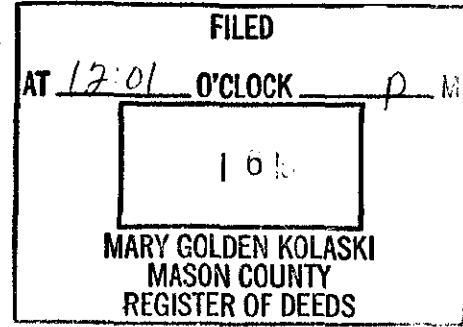

Register of Deeds Stamp & File Number

For corners in

MASON _____ <small>(County)</small>	Located In:	Corner Code #	
1. Public Land Survey	T <u>17N</u> R <u>15W</u>	M-5	_____
	T _____ R _____	_____	_____
	T _____ R _____	_____	_____
	T _____ R _____	_____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____	_____
	S _____ T _____ R _____	_____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____	_____
	S _____ T _____ R _____	_____	_____

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

I, Sammy S. Barnett, in a field survey on AUGUST, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

M-4 1/4 corner, East 1/4 cor., for Sec., 12

Post placed by Mullett & Brookfield in April, 1838 Township Boundary survey.  
N 70° W 331ks. (21.78') 8" Hemlock  
S 25° W 411ks. (27.06') 8" Beech

M-5 Section corner, Sec's., 12 & 13 on Township line

Post placed by Mullett & Brookfield in April, 1838 Township Boundary survey.  
N 62° W 341ks. (22.44') 10" Beech  
S 44° W 251ks. (16.50') 10" Maple

R. D. Towns found stone in March, 1902 Subdivision survey. (No References).

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

M-4 1/4 corner, East 1/4 cor., for Sec., 12

Sam Barnett found 1" Iron Bar, during a survey for John Kistler & Ass. in October, 1972.  
N 75° W 33.82' 20" White Pine  
S 43° W 74.29' Power Pole  
N 58° E 40.20' Tele Pole

M-5 Section corner, Sec's., 12 & 13 on Township line

Sam Barnett found 1 1/2" Iron Pipe, during a survey for John Kistler & Ass., in October, 1972.  
N 41° W 48.75' SE cor. Store building  
N 33° E 65.42' SW cor. Galvz. building  
S 23° E 20.96' NE cor. of NE rail on Bridge


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

M-4 1/4 corner, East 1/4 cor., for Sec., 12

Found 1" Iron Pipe in Monument Box, replaced with 5/8" X 24" re-rod with 2 1/2" alum. cap, and is accepted as the best available evidence of the position of the original corner.  
S 46° E 41.55' 7" White Pine  
S 68° W 101.01' 4" Red Oak  
N 22° W 220.75' 24" White Pine  
N 78° E 83.73' 7" White Pine

M-5 Section corner, Sec's., 12 & 13 on Township line

Found 1/2" Re-Rod in Monument Box, replaced with 5/8" X 24" re-rod with 2 1/2" alum. cap, and is accepted as the best available evidence of the position of the original corner.  
N 76° E 130.03' 18" Blue Spruce  
S 16° E 78.15' Power Pole #2-71  
S 37° W 49.31' Power Pole #6-71  
N 75° W 230.10' Power Pole #293

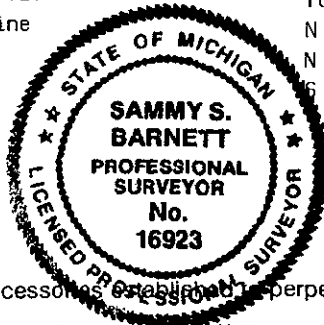

Signed by Sammy S. Barnett  
Surveyor's Michigan License No. 16923

Date 8/24/93

Peer Group Reviewed  
and Approved  
Date: 9-9-93  
[Signature]  
Michigan Board of Land Surveyors  
Mason County Surveyor