

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 18 N. R. 15 W.	C-7; C-8; E-7; E-8
2. PROPERTY CONTROLLING IN SECTION 20	T. 18 N. R. 15 W.	10
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER _____

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 2, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restorations:~~

C. (continued)

E-8	10
Fd. 1/2" Pipe; added DNR Mon. & Cedar Post	Set 3/8"x1/2"x36" iron & Ced. Post w/loc. tag
7" W. Oak N50°E 9.4	4" Maple S20°E 9.0
3" W. Oak N40°W 13.5	6" W. Oak S70°W 9.9
28" Old Pine Stp. N30°W 6.6	N-S Power line Due W 35
8" W. Oak S70°E 3.3	Fd. 1 1/2" pipe N00°29'W 97.4
	Fd. 1 1/2" pipe S00°29'E 232.0

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-7 Fd. & accepted U.S. Forest Service Mon. as set from 1937 wits. by RLS Bill Downey, MSHD; fitting possible USBT pine stump remains. Fd. 1 1/2" pipe as set by Ken Stephens in 1960, N54°27'E, 86.36'.
- C-8 Fd. conc. mon. as estab. by RLS Ken Stephens in 1960. Robt. Griffin, RLS, U.S.F.S. replaced Stephens' conc. mon. with U.S.F.S. mon. on 5/25/78.
- E-7 Fd. & accepted U.S.F.S. mon. as set at 1937 corner position, per RLS Bill Downey, MSHD.
- E-8 Fd. & accepted 1/2" pipe by RLS Sammy Barnett. Corner is in line with fence remains northerly.
- 10 Established 1/16 corner equidistant & on line between 1/4 corner to N & sec. corner to S. Fits E line of "Walhalla Main Branch Subd. on the Pere Marquette River."

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-7	C-8	E-7
Fd. USFS Conc. Mon. & 4" Sq. Post	Fd. 5"x5"x60" USFS Conc. Mon. & 4" Sq. Post	Fd. USFS Concrete Monument
11" B. Oak N30°W 70.44	30" W. Oak S30°W 152.36	RR Xing Sign Post S75°E 65.3
6" R. Pine S50°E 66.76	6" R. Pine N81°W 61.15	SE Cor of Conc. House Found. N30°W 146.8
5" R. Pine S25°W 69.68	Power Pole N40°W 71.95	5" R. Oak S60°W 144.50
Ctr. E-W Trail Due N 24'±		4"x4" Sq. Post Due S 33'
		Ctr. E-W Grvl. Rd. Due N 2'±

SIGNED BY Carl F. Roser DATE 9/17/79

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

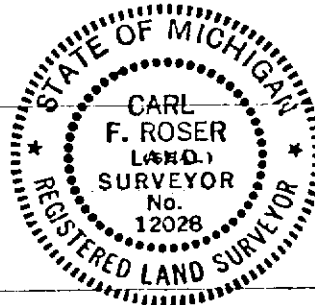

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ BRANCH TOWNSHIP MASON COUNTY