

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 18 N. R. 15 W.	C-9; D-7; D-9; E-9
2. PROPERTY CONTROLLING IN SECTION 20	T. 18 N. R. 15 W.	16
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER \_\_\_\_\_

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on May 2, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restoration~~

C. (continued)

	E-9		16	
Fd. 1 1/2" pipe; added ced. post w/loc. tag			Set 5/8"x40" Rerod & cedar post w/loc. tag	
13" J. Pine	N55°W	62.35	11" R. Oak	N15°W 18.1
5" Maple	N20°W	40.98	14" W. Oak	S55°E 19.2
7" W. Oak	N25°E	25.57	Power Pole	S45°W 17.5
4" W. Pine	S70°E	55.8	Fd. 1 1/4" pipe & post	N60°W 32.1

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-9 Fd. U.S.F.S. Mon. per RLS Bob Griffin who accepted Ken Stephens' 1 1/2" pipe as placed in 1951 in fence post hole. Corner fits C. Landon wit. (1940) within two feet.
- D-7 Fd. & accepted U.S.F.S. mon. as set at 1937 corner position per RLS Bill Downey, MSHD.
- D-9 Reestablished S 1/4 corner, Sec. 20, equidistant & on line between found SE & SW corners of Section 20.
- E-9 Fd. 1 1/2"x4" pipe for SE corner of Sec. 20. Fits wits. by S. Barnett, K. Stephens, C. Landon and Amon.
- 16 Established 1/8 corner equidistant and on line between 1/4 corner to west and section corner to east.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-9	D-7	D-9
Fd. USFS Conc. Mon. & 4"x4" post	Fd. USFS Conc. Mon. & 4" Sq. Post	Set DNR Mon. & Cedar Post
7" R. Pine N20°W 178.87	8" Twn. W. Oak N65°E 54.45	10" B. Oak N80°W 38.3
22" Maple S05°W 87.13	7" R. Pine S20°W 42.00	3" W. Oak N15°W 4.5
7" R. Oak N20°E 116.32	3" R. Pine N15°W 8.6	5" R. Oak N85°E 21.8
	Ctr. E-W Trail Due S 10'±	S'ly edge PM River Due N 456'±8'

SIGNED BY Carl F. Roser DATE 9/17/79

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

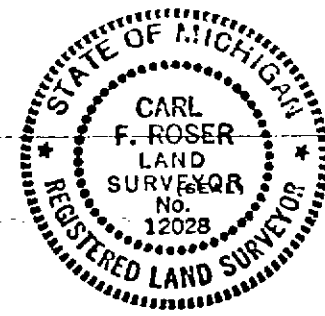

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

BRANCH TOWNSHIP  
MASON COUNTY