

**SURVEY & REMONUMENTATION**

**FEB 08 2000**

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970


**SECTION**

For corners In: Located In: Corner Code #

Mason County

- 1. Public Land Survey T 18N R 15W B-1
- T \_\_\_\_\_ R \_\_\_\_\_
- T \_\_\_\_\_ R \_\_\_\_\_
- T \_\_\_\_\_ R \_\_\_\_\_
- 2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

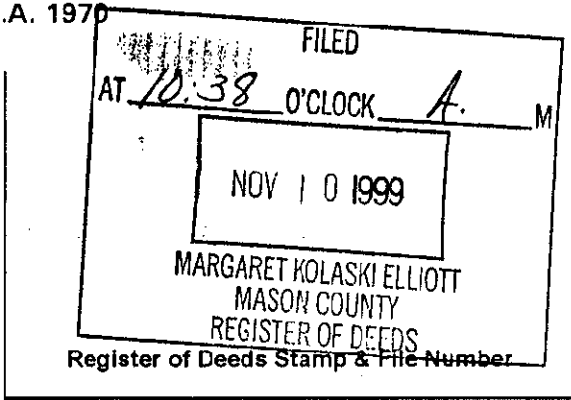

I, Kenneth L. Ross, in a field survey on October 15, 1999, Do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

N 1/4 Corner Section 6, T.18N., R.15W.,

Corner not set by GLO

In my research of this corner I did not find any recorded documentation for this corner. I did have on survey completed by me in 1985 where I tied Corner A-1 and Corner C-1 For a distance of 5241.30' GLO distance was 5235.78'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

N 1/4 Corner Section 6, T.18N., R.15W.,

There being no existing information for this corner and I did not find any existing corner at this location in the field. I re-measured the distance from Corner A-1 to C-1 (5241.31') I then used GLO measurements to prorate the position of this corner. I then set this corner at the following location.

GLO =  $\frac{5235.78'}{5241.31} \times 2640.00'$  = 2642.79' I set Corner B-1 on a straight line between corner A-1 and C-1 at a distance of 2642.79' from From corner C-1.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

N 1/4 Corner Section 6, T.18N., R.15W.,

I set a 3" Harrison Monument stamped "Mason County Monument" at the position described in (B) above, in the center-line of Decker Road, 1.0' below the surface and accepted this location as the best available evidence of the position of the corner.

- (1) Corner B-13, T.19N., R.15W., Set 3" Harrison Cast Iron Monument, West 36.30'
- (2) Set 60d spike, North side of 24" Maple, N80°W, 132.40'
- (3) Set 60d spike SE side of P.P., S44°W, 52.92'
- (4) Distance West to Corner A-1, 2598.52'
- (5) Distance East to Corner C-1, 2642.79'

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

LIBER 4 PAGE 298

Signed by [Signature] Date Nov 4, 1999

Surveyor's Michigan License No. 17634

Approved by Peer Review Group on Nov 4, 1999  
Kenneth L. Ross, County Representative [Signature]

