

DEC 29 1998

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

MASON (County)

Located In:

Corner Code #

- 1. Public Land Survey T 18N R 16W C-9
- 2. Property Controlling in Section S T R
- 3. Miscellaneous Property in Sec. S T R

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

FILED
10 O'Clock 23A
11 NOV
MADY GOLDEN KOLASKI
Register of Deeds Stamp & File Number

I, Kenneth L. Ross, in a field survey on July 23, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

A. Description of original monument and accessories and/or subsequent restoration:

C-9 Section Corner for Sections 19, 20, 29 and 30, T18N-R16W.

1838, Sylvester Sibley, G.L.O.

Set Wood Post

- #1 Sugar 20" N 65 E 17 lks. (11.22')
- #2 Sugar 10" S 60 W 12 lks. (7.92')

J. H. Jones, Mason Co., Surveyor (no date)

Notes corner is a Stone with "X", established by J. A. Mitchell. (book 1 page 75)

1979, Gordon Bonney, RLS # 12016

Found 1" Iron Rod in monument box at the intersection of Conrad and Darr Roads. (Liber 2, pg 73)

- #3 Maple 32" N 20 W 70.60'
- #4 SW corner of house N 38 E 93.30'

Ken Ross, RLS #17634, used this corner in Surveys (file no. 25887s. 20589s. 89289s. E-71)

1899, R.O. Towns, Mason Co. Surveyor (book 2, page 93)
Found Stone with "X"

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-9 Section Corner for Sections 19, 20, 29 and 30, T18N-R16W.

On July 23, 1998, I found 1" Iron Rod in an existing monument box, Iron set on top of existing Stone, I found no evidence to dispute this location for the corner.

Condition of existing witnesses are as follows; #1 Gone #2 Gone #3 Found stump

#4 Found in good condition

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-9 Section Corner for Sections 19, 20, 29 and 30, T18N-R16W.


I replace 1" Iron rod with a 5/8" Re-Rod, in the exact location, with a 3 1/2" aluminum cap, stamped MASON COUNTY MONUMENT. I set re-rod in concrete inside monument box, leaving the cap flush with road surface. This corner is accepted as a careful and faithful re-establishment of the position of the original corner.

- Ext "BT" #4 SW corner of house N 32 E 93.28'
- New "BT" #5 Sugar Maple 45" N 48 E 46.60' (10d nail in SE side of tree)
- New "BT" #6 Power Pole S 55 W 108.52' (PK nail in NW side of pole)
- New "BT" #7 Power Pole N 65 W 100.10' (PK nail in SE side of pole)

Signed by [Signature]

Date Sept 8, 1998

Surveyor's Michigan License No. 17634

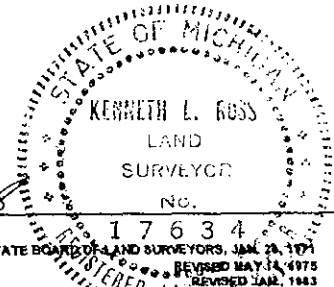

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 24, 1974
REVISED MAY 14, 1975
REVISED JAN. 1983
ADAPTED FOR WORD PROCESSING, MARCH, 1993
Peer Group Reviewed and Approved

Date 9-8-98
[Signature]