

**SURVEY &
REMONUMENTATION**


DEC 18 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MASON</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 18 N R 16 W	K-10
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

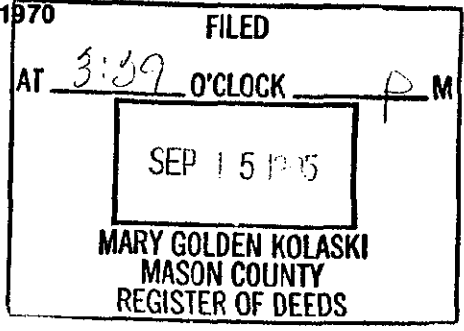

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Sammy S. Barnett, in a field survey on _____, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-10 1/4 Corner for Section 25 and 26, T18N, R16W.

1838, Sylvester Sibley, D.S., G.L.O.
Set wood Post
#1 Pine 14" N 55° E 061ks.(3.96')
#2 Beech 12" S 47° W 131ks.(8.58')

1884, James Jones, D.C.S.
Monument not given
Identify by Gov't. "BT'S", Pine Stp. & fallen Beech

1993 & 1982, Kenneth Ross, M.C.S.
Set 1/2" Iron Rod in fence to the West and Pine Plantation to the East and Center-Line of two-track
#3 Red Pine 12" N 74° E 35.13'
#4 White Oak 12" S 65° E 52.24'
#5 Tw. White Oak 6"/8" S 13° W 101.80'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-10 1/4 Corner for Section 25 and 26, T18N, R16W.

On August 9, 1995, I found a 1/2" Re-Rod set by Ken Ross, found RE-Rod in the center-line of two-track Road, with old fence to the West and Plantation tree line to the East, I found no other Irons or Markers or any other evidence to dispute this location for the Corner.

Condition of Recorded Witnesses is; #1 Found a White Pine Stump SouthEast of Corner 40'+-, but can not confirm as Sibleys Witness tree, #2 Gone #3 Found in good Cond. #4 Found in good cond. #5 Found in good cond.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


K-10 1/4 Corner for Sections 25 and 26, T18N, R16W.

I replaced 1/2" Re-Rod with a 5/8" Re-Rod, 24" long, with an aluminum cap stamped MASON COUNTY MONUMENT Set Monument 0.5' below ground surface, and is a careful and faithful reestablishment of the position of the original corner.

OBT #3 Red Pine 12" N 74° E 35.13' (60d spike in NW side of tree)
OBT #4 White Oak 12" S 65° E 52.24' (60d spike in SW side of tree)
OBT #5 Tw. White Oak 6"/8" S 13° W 101.80' (60d spike in NW side of tree)
White Oak 7" S 14° E 54.75' (60d spike in SW side of tree)

Signed by Sammy S. Barnett Peer Group Reviewed and Approved Date 9-8-95

Surveyor's Michigan License No. 16923 Date: 7-12-95
Kenneth L. Ross
Mason County Surveyor

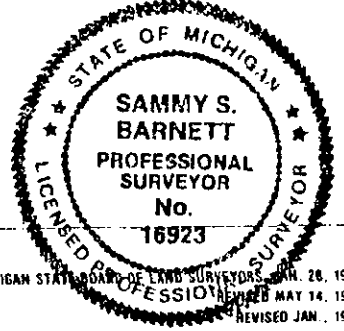

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN. 1983