

SURVEY & REMONUMENTATION

JAN 28 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners In: Located In: Corner Code #

Mason County

1. Public Land Survey	T 18N	R 17W	A-12 ✓
	T 18N	R 18W	M-12
	T	R	
	T	R	
2. Property Controlling in Section	S	T	R
	S	T	R
3. Miscellaneous Property in Sec.	S	T	R
	S	T	R

FILED

AT 9:45 O'CLOCK A. M.

AUG 1 2000

MARGARET KOLASKI FLUITT
MASON COUNTY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Kenneth L. Ross in a field survey on July 26, 2000, Do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Quarter Section corner common to section 31 of T18N, R17W and Section 36 of T18N, R18W.

A. Description of original monument and accessories and/or subsequent restoration:

GLO Mullett & Brookfield 1838 set post 14" Beech S65W 20 lks. (13.20') #1 14" Beech N29W 26 lks. (17.16') #2	MDOT undated Scribed "X" cut in conc. pavement of old US 31	LCRC Hooth PLS 7966 L1 P327 Jan. 1977 RR spike set at "X" cut in pavement 8" pine N60E 49.65' #7 6" pine N75E 84.26' #8 Road sign post S30E 44.54' #3 TP N55W 36.25' #6
Stephens RLS 7318, 1967 for Consumers Power Co. "X" in concrete pavement Rd. sign S22E 44.57' #3 TP S69E 71.3' #4 PP N75E 88.34' #5 TP N56W 36.34' #6 Distance to M-13 is 2633.97'	LCRC Fluharty 18223 L 2 P257 Fd. spike 12" Jack pine N66E 54.25' #9 PP N50W 38.24' #8 Center of Street sign S25E 44.65' #3	Ross RLS 17634 1983 (unrecorded survey) No identification of corner Rd. Name sign S22E 44.57' #3 PP N75E 88.34' #5 Centerline is 3' east 10" scotch pine NE 54.25' #5
MCRC Same as Stephens witnesses.	Dunlap RLS 21759 L311 P606 1983 No witnesses or description	

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a boat spike in concrete road 2.8' West of center of a N-S rd. and 5' North of the centerline of a road to the East.


The condition of the accessories are as follows: 1, 2, 3, 4, and 6 are gone 5, 7, 8 and 9 are in good condition.

I found nothing to dispute the location of this corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I removed the boat spike and set a Harrison Monument in a monument box stamped "Mason County Monument PLS 17634" in the exact location. I accepted this as a careful and faithful reestablishment of the position of the original corner.

Power pole S30E 30.60' (ex. 60d spike in SW side)
Power pole N80E 87.34' (ex. 60d spike in S. side) #5
11" scotch pine N73E 54.12' (Ex. 60d nail on E. side) #9
10" cherry S21W 86.18' (set 60d spike on E. side)
Distance to M-13 is 2634.36'

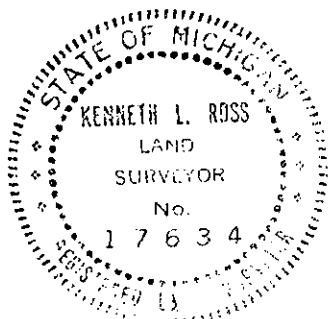

Signed by [Signature] Date 8-10-2000
Surveyor's Michigan License No. 17634

Approved by Peer Review Group on 8-10-2000
Kenneth L. Ross, County Representative [Signature]

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28,

1971
REVISED MAY 14, 1978
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993