

DEC 18 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
MASON _____
(County)

Located In: _____ Corner Code # _____


1. Public Land Survey T 18 N R 17W G-3
T _____ R _____
T _____ R _____
T _____ R _____

2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

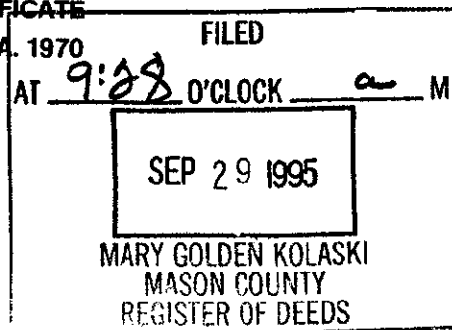

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3	7	8	9	10	11	12							
4													
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Sammy S. Barnett, in a field survey on September 15, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-3 Section Corner for Sections 3, 4, 9 and 10, T18N, R17W

1838, Sylvester Sibley, DS, G.L.O.
Set Wood Post
#1 Beech 10" S10°W 261k.(17.16')
#2 Maple 10" N22°E 291k.(19.14')
1883, C.E. Mitchell, MCS
Stone & Stump of old witness tree

1957, M.C.R.C.
R. Lunde, Identified as a Iron
#3 Conc. Mon. NE 47'
#4 Ash 9" NE 81.3'
#5 Power Pole SE 37.3'
#6 Maple Stump 10" SE 39.8'

#7 Tel-Pole SW 62.7'
#8 Maple 15" NW 65'
1973, Ken Ross, MCS
PK Nail, over Iron
#9 Power Pole SE 37.64'
#10 Road Name Sign SW 53.90'
#11 Maple 36" NW 65.19'
#12 Conc. Mon. NE 47.00'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: 1992, Ted Weinert, RLS,

G-3 Section Corner for Sections 3, 4, 9 and 10, T18N, R17W

Found 1½" Iron Pipe in Mon. Box
#13 Power Pole S75°E 64.51'
#14 Power Pole S25°E 55.95'
#15 Post N44°W 58.90'

ON September 15, 1995, I found a 1½" steel post inside a road monument box, at the intersection of Hansen and Stiles Roads, this location fit existing witnesses and I found no other evidence to dispute this location for the corner.

Condition of recodred witnesses is; #1 Gone #2 Gone #3 Found in good cond. #4 Gone #5 Gone #6 Gone #7 Gone #8 Found in good cond. #9 Same as 5 #10 Gone #11 Same as 8 #12 Same as 3 #13 Found in good cond. #14 Found in good cond. #15 Found in good cond.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-3 Section Corner for Section 3, 4, 9 and 10, T18N, R17W

I replace 1½" fence Post with a 5/8" Re-rod, 24" long, with an aluminum cap(2½" in dia.), stamped MASON COUNTY MONUMENT, placed monument inside the existing road monument box, and is accepted as a careful and faithful reestablishment of the position of the original corner.

OBT #8 Maple 38" N 38° W 65.19'(60d spike in NE side of tree)
OBT #13 Power Pole S 60° E 64.42'(60d spike in NE side of pole)
OBT #14 Power Pole S 30° E 64.42'(60d spike in NE side of pole)
OBT #15 Post, ~~wood~~ N 44° W 58.90'(60d spike in SW side of post)

Signed by Sammy S. Barnett
Surveyor's Michigan License No. 16923

Peer Group Reviewed Date 9-28-95
and Approved

Date: 9-28-95 FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISIED MAY 14, 1975
REVISIED JAN., 1983
Kenneth L. Ross
Mason County Surveyor

