


SURVEY & RE-MONUMENTATION

JAN 23 2001 LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **SECTION 9** Located In: _____ Corner Code # _____
Mason County

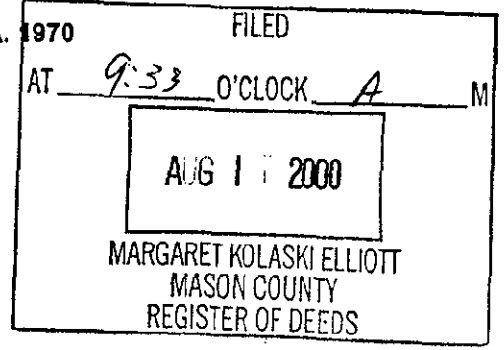

- 1. Public Land Survey T 18N R 17W A-7
T 18N R 18W M-7 ✓
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

- 4. Lot No. _____ Recorded Plat _____
- 5. Private Claims _____

I, Kenneth L. Ross in a field survey on June 8, 2000, Do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|----|----|----|----|----|---|---|---|---|---|---|---|
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | | |

¼ corner common to section 18 and 19 of T18N, R17W and section 13 and 24 of T18N, R18W.

A. Description of original monument and accessories and/or subsequent restoration:

- Mullett and Brookfield 1838 set post Pine 10" S83W 4 lks (2.64') #1 Hem. 8" N28W 11 lks. (7.26) #2
- Ed McCombs 1974 for Consumers Power Co. Fd. Concrete monument REA pole NW 44.9' #3 CPCo. Pole SW 82.55' #4 Fence Cor. Post SE 45.4' #5 4" Pine NE 84.4' #6
- Ross RLS 17634 Liber 1 Page 253 Act 74 Sept. 1974 Ex. ½" pin Cen E-W rd. 2.5' E of N-S rd. PP N30W 46.79' #7 Power line brace pole N60E 62.27' #8 Gas line marker S40W 58.10' #9
- Stephens RLS 7318 Unrec. 1954 "existing concrete monument" No witnesses taken.
- Stephens RLS 7318 1969 Unrecorded survey no wit. or identification
- MCRC undated Same as Ed McCombs for Consumers Power 1974
- Richard Hays PLS 25847 Unrecorded survey of 3 parcels Nothing referenced or no witnesses.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a RR spike as a riser for ¾" solid iron rod in a monument box. The solid iron may be the iron in the Concrete monument described in part A but I did not confirm this. Cen E-W rd. 2.5' E of N-S rd.


Condition of the accessories are as follows: 1, 2, 3, 5, 6 and 7 are gone 4, 8 and 9 are in good condition.

I found nothing to dispute the location of this corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I set an 2 ½" Aluminum cap on a 5/8" X 6" iron rod as a riser for the solid ¾" iron in the monument box. Said cap stamped Mason County Monument PLS 17634. I accepted this as a careful and faithful reestablishment of the position of the original corner.

- Gas line marker S36W 58.03' #9
- PP S74W 79.05' Ex. PK nail N side
- PP N32W 49.82' Ex. 16d nail on E side
- Center-top of Fire Hyd. N23W 59.35'
- PP N58E 62.20' Ex. PK on N side #8
- Cen E-W rd. 2.5' E of N-S rd.

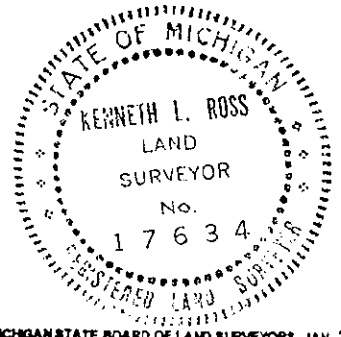

Signed by [Signature] Date 8-10-2000
Surveyor's Michigan License No. 17634

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28,

1971
REVISED MAY 14, 1975
REVISED JAN., 1993
ADAPTED FOR WORD PROCESSING MARCH, 1993

Approved by Peer Review Group on 8-10-2000
Kenneth L. Ross, County Representative [Signature]