

SURVEY & REMONUMENTATION

MAR 16 1998

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in SECTION


MASON (County)

Located In:

Corner Code #

- 1. Public Land Survey T 19N R 16W
T 20N R 16W
I R
T R
- 2. Property Controlling S T R
in Section S T R
- 3. Miscellaneous S T R
Property in Sec. S T R

L-01 ✓
L-13

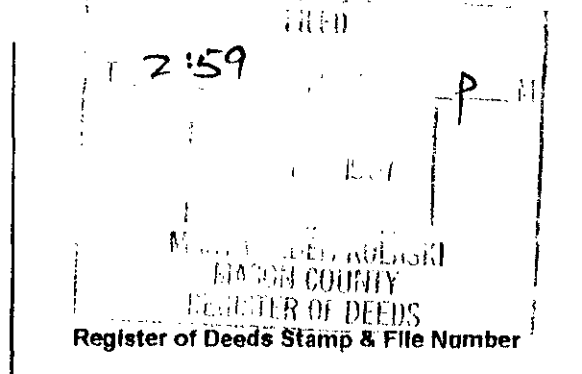

- 4. Lot No. _____ Recorded Plat _____
- 5. Private Claims _____

I, Kenneth L. Ross, in a field survey on 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

L-01 North 1/4 for Section 1, T19N-R16W. and
1837, G.L.O. Mullett & Brookfield
Note: Did not set this corner.

L-13 South 1/4 for Section 36, T20N-R16W.
1837, Mullett & Brookfield, G.L.O.
Set Wood Post
#1 Black Oak 6" N 55° E 39 lks. (25.74')
#2 White Pine 10" N 80° W 07 lks. (4.62')

1903, R.O. Towns, Mason co. Surveyor.
Towns shows corner as a stone with "X" on Drawing in Book 4, Page 106. Gives a distance of 2665.08' to M-01 (NE cor. Sec. 1, T19N-R16W) and a distance of 2645.28' to K-01, (NW cor, Sec. 1 T19N-R16W).

1955, Kenneth Stephens, RLS # 7318
3/4" Iron Pipe
#3 P.O.B. for the "plat of Oakwood Shores" N35°E 201.43' to Conc. Monument

1959 Kenneth Stephens, RLS #7318
Used exiting 3/4" Iron in Survey
#1 Set 3/4' Iron Pipe Due West 50.00 feet

Undated survey notes Kenneth Stephens,
Pipe
#4 Oak 18" NE 50.00 feet
#5 Oak 48" SE 71.00 feet
#6 Oak 14" South 55.00 feet
#7 Tw. Poplar North 4.00 North
1966, Robert A. Griffin, RLS. 13584
Replaced Stephens 3/4" Iron Pipe encase in conc, w/ a 5" square x 60" conc. monu w/ a 3" brass cap, stamped T20N-R16W, S1/4 Cor. Sec. 36, 1966
#8 SW cor. of Foundation (conc) of wood frame cabin N 36° E 148.29'
#9 White Oak N 79° E 50.90'
#10 Red Oak 56" S 34° E 73.05'
#11 Red Oak 3" N 01° W 40.25'

1962, Kenneth Stephens, RLS #7318
Used exiting 3/4" Iron in Conc.
Job # 60-62 H-106

1982, Ross Surveys, Ken Ross, RLS#17634
Used Existing U.S.F.S. Conc. Monument in Survey, File No. H-310

1985, Richard Hays, RLS # 25847
Used Griffin Conc. Monu. in Survey,
1997, Rex Pope, RLS # 39093
Used Griffin Conc. Mon. L. 4 Pg. 105

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-01 North 1/4 for Section 1, T19N-R16W. and L-13 South 1/4 for Section 36, T20N
On October 24, I found Griffin's 5" square concrete monument (note no corner chip off), corner is 1.5 feet above the ground. Condition of recorded witnesses are: L-01 #1 Found in good condition L-13 #1 Gone #2 Gone #3 Found in good condition #4 Found in good condition #5 Found in good condition #6 Found in good condition #7 Gone #8 Found in good condition #9 Same as 4 #10 Same as 5 #11 Found in good condition


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-01 North 1/4 for Section 1, T19N-R16W. and L-13 South 1/4 for Section 36, T20N
I accepted 5" square concrete monument as a substantial marker for the corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.
Ext"BT" #6 Black Oak 33" S 28° W 55.60 ft. (no nail set this is a play area)
Ext"BT" #9 White Oak 60" N 79° E 50.90 ft. (no nail set this is a play area)
Ext"BT" #10 Red Oak 70" S 34° E 73.05 ft. (no nail set this is a play area)
Ext"BT" #11 Red Oak 15" N 01° W 40.25 ft. (no nail set this is a play area)

Signed by [Signature] Date Nov. 5, 1997

Surveyor's Michigan License No. 17634

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1974

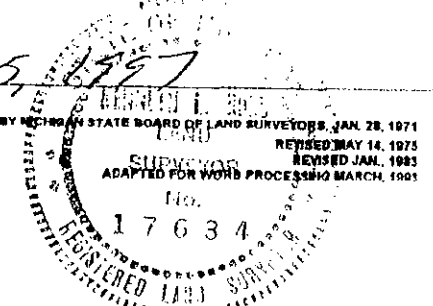

Peer Group Reviewed and Accepted
Date: Nov 14, 1997
[Signature]
Kenneth L. Ross
Mason County Surveyor