

DEC 9 1998

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Mason (County)

Located In:

Corner Code #

- 1. Public Land Survey T 19N R 17W G-8
2. Property Controlling in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

- 4. Lot No. Recorded Plat
5. Private Claims

I, Kenneth L. Ross, in a field survey on October 24, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- ORIGINAL GOVERNMENT SURVEY Section Survey by Sylvester Silbely 1838 to 1839, Set Post
(1) Lynn, 10", N49°W, 9.90'
(2) Birch, 10", S64°E, 15.84'
W.E. Metcalf, 1888, Book 1, pg. 209 States Set by Measurement
(3) Pine Stump, 30", N46°E, 27.72'
(4) Pine Stump, 30", N07°E, 44.36'
Distance North to G-7, 2603.04'
Distance South to G-9, 2603.04'
Kenneth L. Ross, Survey, 1984, unrecorded File No. H-341 No Witnesses Given.
Distance North to G-7, 2612.38'
Set 1/2 way on line Set RR Spike
Kenneth L. Ross, Survey, 1991, unrecorded File No. 01891S, Ex. RR Spike No Witnesses
Distance South to G-9, 2612.38'
Set 1/2 way on Line

Theodore H. Weinert, LCRC, Liber 3, Page 64, Mason Co. Records 1992, Fd. 1" Iron Pin replaced with 1 1/4" X 24" Iron Pipe and Monument Box
(5) P.P. N55°E, 33.35'
(6) P.P. S30°W, 64.68'
(7) Guard Rail Post, S50°E, 25.78'
Kenneth L. Ross, Survey, Unrecorded 1995. File No. 95295S
No Witnesses Given.
Distance South to G-9, 2612.38'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found a 1 1/4" pipe inside a monument box in the centerline of Stiles Road.

Condition of record witnesses as follows: (1) gone, (2) gone, (3) gone, (4) gone, (5) good condition, (6) good condition, (7) good condition.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set a 5/8" X 24" re-rod inside the 1 1/4" Pipe inside the monument box with a 3 1/4" aluminum cap stamped "Mason County Monument". This corner accepted as a careful and faithful re-establishment of the location of the original corner.

- Ex "BT" (5) P.P. N 55°E, 33.35 feet, (60d spike NW side)
Ex "BT" (6) P.P. S 30°W, 64.68 feet, (60d spike SE side)
Ex "B.T." (7) Guard Rail Post, S45°E, 25.61 feet (Set 60d spike top of post)
(8) Guard Rail Post, S 45°W, 24.95 feet, (Set 60d spike top of post)

Signed by [Signature] Date 11-19-98

Surveyor's Michigan License No. 17634

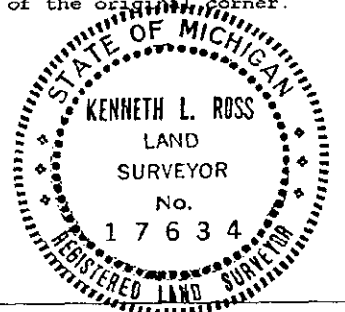

Approved by Peer Review Group On 11-19-98
Kenneth L. Ross, County Representative [Signature]

Grid table with columns A-M and rows 1-13. Cell (8,8) contains a black dot.

