


**SURVEY & REMONUMENTATION**

MAR 16 1998

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

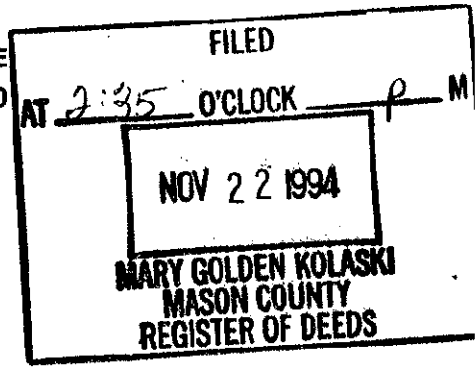

SECTION  
For corners in

MASON (County)

Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_

1. Public Land Survey T 19N R 17W A-12  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

*Seg. 2*

Register of Deeds Stamp & File Number

I, Theodore H. Weinert, in a field survey on OCTOBER, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

A-12 1/4 Corner, Secs. 31-19-17 & 36-19-18

G.L.O. Notes Set Post  
July, 1838, Sylvester Sibley  
10" Beech S 54 W 22 lks  
10" Beech N 45 W 4 lks  
No surveys of record recorded  
August 22, 1975, James T. Nordlund Fd iron pipe  
(Liber 1, Page 381)  
1974 T. Weinert Fd corner on an uncompleted survey

1985 Ken Ross, PLS, Fd corner while completing a survey for the Mason County Road Commission April 12, 1994, Nordlund & Associates tied this corner (not recorded as of this date) No records found prior to 1974 other than original government survey

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


A-12 1/4 Corner, Secs. 31-19-17 & 36-19-18

Found 1/2" X 18" rebar & cap.  
Location matched distances east-west and north-south of surveys by T. Weinert, Nordlund, and Ken Ross, PLS  
This corner location is accepted as a careful and faithful perpetuation of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-12 1/4 Corner, Secs. 31-19-17 & 36-19-18

Replaced 1/2" X 18" rebar with 5/8" X 36" rerod with standard 2 1/2" cap stamped "Mason County Remonumentation".  
13" W. Pine N 70 E 93.50'  
9" Ash S 05 W 41.21'  
P. Pole N 48 W 53.23'  
Iron & Cap North 33.00'  
8" Cherry S 60 E 67.45'  
6" Maple S 30 W 32.70'

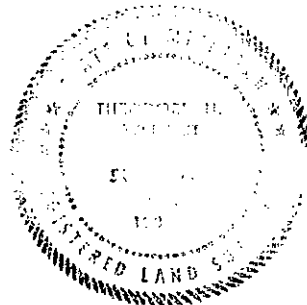

Peer Group Reviewed and Approved  
Date: 11/16/94  
*Kenneth L. Ross*  
Mason County Surveyor

Signed by Theodore H. Weinert

Date 11/16/94

Surveyor's Michigan License No. \_\_\_\_\_ Peer Group Reviewed and Approved

Date: 11-7-94  
*Kenneth L. Ross*  
ROSS