

**SURVEY & REMONUMENTATION**

**APR 28 1995 LAND CORNER RECORDATION CERTIFICATE**

**COMMISSION FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970**

FILED

AT 10:10 O'CLOCK a M

**NOV 17 1994**

**MARY GOLDEN KOLASKI**  
**MASON COUNTY**  
**REGISTER OF DEEDS**

REGISTER OF DEEDS STAMP AND FILING NUMBER

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>20N</u> N. S., R. <u>15W</u> E. W.	D3
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S., R. _____ E. W.	<u>Seg. 1</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on October 30 1994, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

- 1/4 corner common to sections 5 and 8 of T20N R15W**
- |  |   |   |
|--|---|---|
| <b>1839 survey by John Brink</b><br>Set Wood Post<br>#1 P. Pine 4 S21W 8 links<br>#2 P. Pine 3 N32W 15 links | <b>1974 survey by C. Cole #17615</b><br>.Fd. Concrete Monument<br>#6 W. Oak 13 N83E 57.46 feet<br>#7 B. Oak 9 S54E 32.76 feet<br>#8 W. Oak 11 S28E 48.53 feet | <b>1971 survey by Robert A. Griffin #13584</b><br>Searched for and fd. the concrete monument. Replaced it with a 5" sq. by 60" long conc. monument w/ brass cap.<br>#5 P. Post 4 North 1.65 feet<br>#6 W. Oak 13 N83E 57.46 feet<br>#7 B. Oak 9 S54E 32.76 feet<br>#8 W. Oak 11 S28E 48.53 feet |
|--|---|---|
- 1938 search by R. Willsie USFS**  
 #3 J. Pine 12 S16W 94 links  
 #4 Cedar Post 3 North 1 link  
*(Willsie for a Conc. Monu at this time)*  
*R/W 11/16/94*

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

I found the 5" square by 60" long concrete monument w/ brass cap by Griffin 250 feet South of the centerline of the E-W 2-track. Witnesses 1 through 3 are gone. Witness 5 through 8 are in good condition. Witness #4 has fallen over. Liber 1 Page 55 by Griffin documents the history of this corner. I could find no conflicting information that would lead to another location. This monument is accepted as the best available evidence of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**1/4 corner common to sections 5 and 8 of T20N R15W**  
 Monu. The 5" square by 60" long concrete monu. with 3" brass disk was left in place.  
 Witnesses:  
 B Oak 10 S59W 46.36 feet  
 B Oak 8 N33W 52.82 feet  
 P. Post 4 North 1.65 feet (#5)  
 W. Oak 16 N83E 57.48 feet (#6)  
 B Oak 13 S60E 32.75 feet (#7)  
 W. Oak 14 S32E 48.51 feet (#8)

For Group Review and Approval  
 Date 11-17-94  
*Kenneth L. Rida*  
 Mason County Surveyor


SIGNED BY *Patrick R. Leemon* DATE October 30, 1994

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

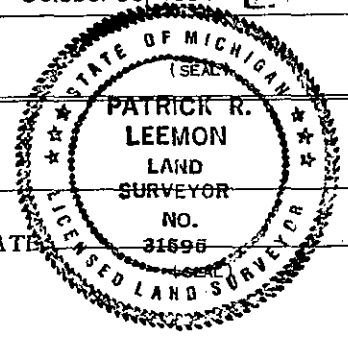

LIBER **3** PAGE **201**

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_