

MAR 16 1998 LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

SECTION

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. _____	20N N. 15W E. S., R. W.	E3
2. PROPERTY CONTROLLING IN SECTION _____ T. _____	N. S., R. E. W.	<i>Seg. 2</i>
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____	N. S., R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

FILED

AT 10:10 O'CLOCK *a*

NOV 17 1994

MARY GOLDEN KOLASKI
MASON COUNTY
REGISTER OF DEEDS

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on October 30 1994, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Section corner common to sections 4, 5, 8 and 9 of T20N R15W

1838 survey by John Brink Set Wood Post #1 P.Pine 4 S53E 4 links #2 P.Pine 4 N83W 7 links	1918 survey by C.E. Mitchell Co. Sur. Set Concrete Monument #3 W.Oak 15 N27W 194 links #4 R.Oak 8 S75E 146 links	1971 survey by Robert A. Griffin #13584 Searched for and found the concrete monument by Mitchell. Replaced it w/ a 5" sq. by 60" long conc. monument w/ 3" brass cap. #8 W.Oak 9 N65E 74.31feet #5 B.Oak 18 S81E 12.38 feet #9 Tw.W.Oak 7x8 S46E 86.53 feet #10 W.Oak 8 West 105.03 feet #11 B.Oak 5 N73W 73.86 feet
1938 Search by Ray Lyons USFS Fd. concrete monument #5 B.Oak 12 S81E .18 chains #6 W.Oak 18 S23W 1.46 chains #7 B.Oak 8 N82W 1.28 chains	1974 survey by C.Cole #17615 Used witnesses #8, 5 and 11	

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the 5" square by 60" long concrete monument w/ brass cap by Griffin 158 feet North of the centerline of the E-W trail road, off the centerline of the road to the North and 11 feet east of centerline of the curve. Witnesses 1 through 4 and 7 are gone. Witness 9 is not longer a twin as one tree fell over. Witnesses 5, 8, 10 and 11 are in good condition. Liber 1 Page 42 by Griffin documents the history of this corner. I could find no conflicting information that would lead to another location. This monument is accepted as the best available evidence of the position of the original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Section corner common to sections 4, 5, 8 and 9 of T20N R15W

Monu. The 5" square by 60" long concrete monu. with 3" brass disk was left in place.

Witnesses:

- Iron fence post North 1.45 feet
- W.Oak 11 S68E 64.40 feet
- W.Oak 11 S46E 87.02 feet (#9)
- W.Oak 12 N68E 74.32 feet (#8)
- B.Oak 22 S85E 12.15 feet (#5)
- W.Oak 9 S86W 105.05 feet (#10)
- B.Oak 8 N73W 73.84 feet (#11)

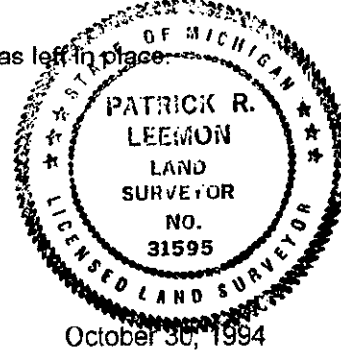

Peer Group Reviewed and Approved
Date: 10-25-94
Kenneth L. Ross
Mason County Surveyor

Peer Group Reviewed and Approved
Date: 10-25-94
Kenneth L. Ross
Mason County Surveyor

SIGNED BY *Patrick R. Leemon* DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595 (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)