

SURVEY & REMONUMENTATION


OCT 29 1996

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MASON</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T 20N R 15W	H-11
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

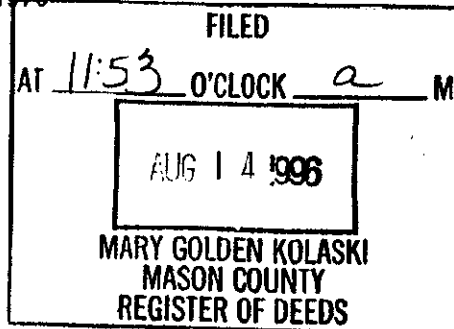

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Sammy S. Barnett, in a field survey on July 23, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

H-11 1/4 Corner for Sections 27 and 34, T20N, R15W.

1839, John Brink, G.L.O.

Set Wood post

#1 W. Pine 10" S 70° W 211ks.(13.86')

#2 Spruce 13" N 71° E 481ks.(31.68')

1976, Ken Ross, #17634

Set 1" Iron pipe @ single proportional method (cont.)

#3 Pipe 1" North 33.00'

#4 Tri. Cherry 12"-10" N10°E 94.35'

#5 Cherry 6" S20°W 24.93'

1977, R.A. Griffin

Found 1" Pipe by Ross

#6 Cherry 5" S36°W 24.90'

#7 1" Pipe North 33.00'

Ross cap

#8 Pipe @ center 6"x 42" North 33.92'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-11 1/4 Corner for Sections 27 and 34, T20N, R15W.

I found a 1" Iron Pipe, with RLS cap 17634, Ross at the South edge of trail Road, located 1" Iron pipe 33.00' North, and 6" Iron pipe 33.92' North, I found no evidence to dispute this location for the corner

Condition of recorded witnesses are;

#1 Gone

#2 Gone

#3 Found in good condition

#4 Found in good condition

#5 Found in good condition

#6 Same as 5

#7 Same as 3

#8 Found in good condition

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-11 1/4 corner for Sections 27 and 34, T20N, R15W.

I replaced 1" Iron Pipe, in the exact location with a Standard Mason County Monument, set 0.7' below the trail surface (dirt), and is accepted as a careful and faithful reestablishment of the position of original corner.

(ext. BT #5) Wild Cherry 6" S 32° W 24.94'(60d spike in SE side of tree)

(ext. BT #4) Wild Cherry 18" N 20° E 94.30'(60d spike in NW side of tree)

Jack Pine 9" N 30° W 71.35'(60d spike in NE side of tree)

Jack Pine 8" S 75° E 78.38'(60d spike in SW side of tree)

Signed by Sammy S. Barnett


Date 8-12-96

Surveyor's Michigan License No. 16923

Peer Group Reviewed and Approved

Date: 8-12-96

Kenneth L. Ross
Mason County Surveyor

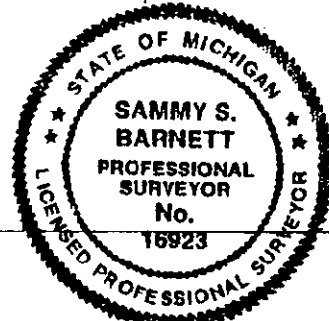

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1985