

DEC 18 1995

COMMISSION LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --: LOCATED IN --: CORNER CODE NUMBER


1. PUBLIC LAND SURVEY _____ T. _____ 20N N. 15W E. K5
S., R. _____ W.

2. PROPERTY CONTROLLING IN SECTION _____ T. _____ N. _____ E. _____
S., R. _____ W.

3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. _____ E. _____
S., R. _____ W.

4. LOT NO. _____, RECORDED PLAT _____

5. PRIVATE CLAIMS _____

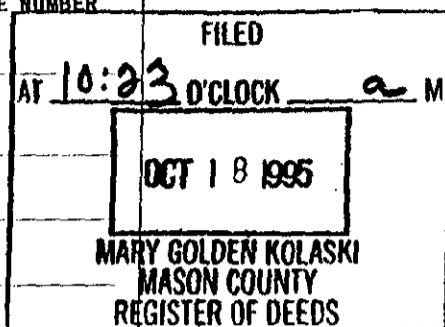

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Patrick R. Leemon do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on October 15, 1995, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Section corner common to sections 11, 12, 13 and 14 of T20N R15W

1839 survey by John Brink Set Wood Post, (1) Y.Pine 10 N30E 620 links, (2) P.Pine 7 N11W 490 links
1904 survey by Robert O. Towns Fd. both GLO BT's, (3) W.Oak 12 N20-30W 397 links, W1/4 12 North 2618.88 ft., S1/4 12 East 2699.4 ft.
1975 survey by Nordlund and Assoc. Fd. 3/4" Iron Pipe, (4) Pine 6 N16E 20.49 ft., (5) Pine 6 S36W 22.12 ft., (6) Pine 6 S60E 22.49 ft., E1/4 11 N0-22-27W 2626.12 ft., S1/4 11 N89-21-29W 2692.94 ft.
1981 survey by Robert A. Griffin #13584 LCRC Liber 2 Page 92, replaced the 1/2"x12" iron pipe with a 1 1/2"x60" iron pipe w/brass cap, (4) Scotch Pine 7 N19E 20.53 ft., (6) Scotch Pine 7 S60E 22.51 ft., (5) Scotch Pine 6 S36W 22.13 ft., (7) Iron Pipe 1 1/2"x60" West 1.7 ft.
1984 survey by Dennis W. Dunlap # 21759 LCRC Liber 2 Page 266, 1 1/2" pipe w/brass cap, same witnesses as Griffin, W1/4 12 N2-37-09W 2623.68 ft., S1/4 12 N88-15-11E 2699.48 ft.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I found the 1 1/2" x 60" Iron Pipe w/ brass cap by Griffin in good condition, protruding 20" above the dried up pond bottom, with dead J.Pine all about, 500 feet south of the centerline of the NE-SW road and 275 feet east of the east edge of the woods. Witnesses 1 through 3 are gone. Witnesses 4 through 6 are dead. Witness 7 is in good condition. This location is in agreement with the GLO calls. I could find no conflicting information that would lead to another location. This monument is accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Section corner common to sections 11, 12, 13 and 14 of T20N R15W

Monu. The 1 1/2" x 60" Iron Pipe filled with concrete w/ brass cap was left in place.

Witnesses:

Rebar 1/2"x24" #31595 N15E 30.10 ft.
Rebar 1/2"x24" #31595 S20E 28.39 ft.
Rebar 1/2"x24" #31595 S63W 27.15 ft.
Iron Pipe 1 1/2"x60" West 1.68 ft. (7)

Peer Group Reviewed and Approved
Date: _____
Kenneth L. Ross
Mason County Surveyor


SIGNED BY Patrick R. Leemon DATE October 15, 1995

SURVEYOR'S MICHIGAN REGISTRATION NO. 31595

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

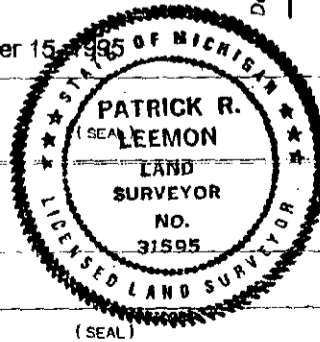

LIBER 3 PAGE 317

SURVEYOR'S MICHIGAN REGISTRATION NO. _____