

SURVEY & REMONUMENTATION


SEP 30 1993

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MASON _____ <small>(County)</small>	Located In:	Corner Code #
1. Public Land Survey	T <u>20</u> N R <u>16</u> W	<u>E-7</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

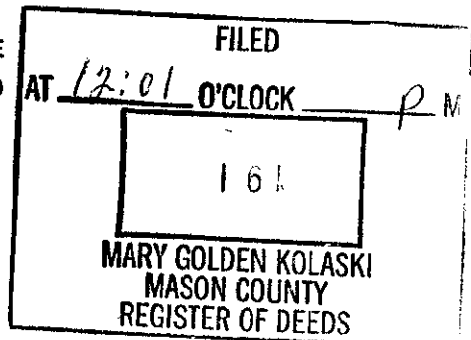

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Sammy S. Barnett, in a field survey on August, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-7 Section corner, Sec's., 16, 17, 20, & 21

Post placed by John Brink in 1839 subdivision survey.

S 38° E 16 lks. (10.56') 14" Elm
 N 75° W 28 lks. (18.48') 10" Cedar

R. D. Towns found Gov't. witness tree standing in April, 1898 survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-7 Section corner, Sec's., 16, 17, 20, & 21

Ken Ross placed 1/2" re-rod, with R.L.S. cap. in July 1989 survey.

N 41° E 15.79' 12" Maple
 N 58° W 5.25' 4" Black Ash
 S 60° W 20.27' 6" Black Ash

NOTE: Re-rod in Center Line of old road grade (Tuttle), 195' South of Big Sable River, G.L.O. had stream call at 3 chains (198').

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-7 Section corner, Sec's., 16, 17, 20, & 21

Found 1/2" Re-rod and replaced with 5/8" Re-rod X 24" with alum. cap, and is accepted as a careful and faithful perpetuation of the position of the original corner.

N 55° E 18.61' 9" Sugar Maple
 S 20° W 26.62' 5" Black Ash
 N 58° W 5.25' 5" Black Ash
 S 60° W 20.27' 7" Black Ash
 N 41° E 15.79' 13" Tw. Sugar Maple

Signed by Sammy S. Barnett Date 9/9/93

Surveyor's Michigan License No. 16923

Peer Group Reviewed
and Approved
Date: 9-9-93
Kenross
Kenneth L. Ross
Mason County Surveyor

