


SURVEY & REMONUMENTATION

SEP 30 1993

COMMISSION

Handwritten scribble

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

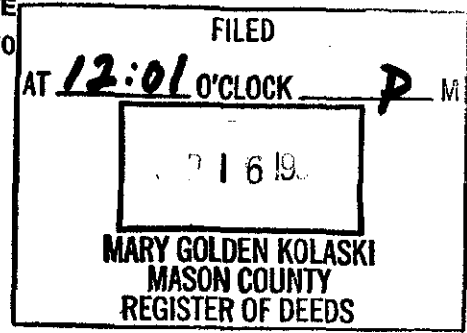

Register of Deeds Stamp & File Number

For corners in
MASON

(County)

Located In:

Corner Code ##

- | | | |
|------------------------------------|-------------------------|---------|
| 1. Public Land Survey | T 20 N R 16 W | G-5 F-5 |
| | T _____ R _____ | |
| | T _____ R _____ | |
| | T _____ R _____ | |
| 2. Property Controlling in Section | S _____ T _____ R _____ | |
| | S _____ T _____ R _____ | |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | |
| | S _____ T _____ R _____ | |

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Sammy S. Barnett, in a field survey on August, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

G-5 Section corner, Sec's., 9, 10, 15 & 16

F-5 1/4 corner, Sec's., 9 & 16

Post placed by John Brink in 1839 subdivision survey.
N 46° W 31 lks. (20.46') 14" Hemlock
S 76° W 21 lks. (13.86') 10" Beech

Post placed by John Brink in 1839 subdivision survey.
S 28° W 17 lks. (11.2') 10" Beech
N 65° W 6 lks. (3.96') 10" Beech

R. O. Towns found remains of Beech
S 28° W 17 lks. in April, 1989 survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-5 Section corner, Sec's., 9, 10, 15 & 16

F-5 1/4 corner, Sec's., 9 & 16

Mason County Road Comm. placed 3/4" rod over 1/2" X 12" pipe.
NE 29.6' Fence Post
East 23.9' C/L culvert pipe
SE 51.0' Wire woven Fence
Norm Caldwell found 3/4" rod, and replaced with 2 1/2" X 30" stainless steel pipe w/ brass cap, in July, 1991 subdivision survey.
N 50° W 41.53' Power Pole
S 40° W 55.20' Guy Pole
S 57° E 78.52' 12" Scotch Pine
N 41° E 57.45' 8" Poplar

Robert Griffin (U.S.F.S.) found Iron rod raised with 1/2" Iron Pin in 1976 corner search.
N 52° E 51.30' Power Pole
S 13° E 49.50' 4" Twin Maple
Ken Ross found 1/2" Iron Pin in August, 1977 survey.
NORM Caldwell found 1/2" Iron Pin, replaced with 2 1/2" X 30" stainless steel pipe w/ brass cap, in July, 1991 survey.
N 33° E 45.53' 30" White Oak
N 52° E 51.23' Power Pole
S 38° E 45.26' 8" Poplar
S 10° E 49.55' 6" Sugar Maple


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-5 Section corner, Sec's., 9, 10, 15 & 16

F-5 1/4 corner, Sec's., 9 & 16

Found 2 1/2" X 30" stainless steel pipe w/ brass cap, accepted as a substantial marker for corner, also recovered Caldwell witness and is accepted as the best available evidence of the position of the original corner.
N 50° W 41.53' Power Pole
S 40° W 55.20' Guy Pole
S 57° E 78.52' 12" Scotch Pine
N 41° E 57.45' 8" Poplar

Found 2 1/2" X 30" stainless steel pipe w/ brass cap, accepted as a substantial marker for corner, also recovered Caldwell witness and is accepted as the best available evidence of the position of the original corner.
N 33° E 45.53' 30" White Oak
N 52° E 51.23' Power Pole
S 38° E 45.26' 8" Poplar
S 10° E 49.55' 6" Sugar Maple

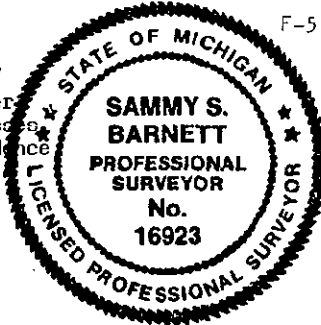

Signed by Sammy S. Barnett Date 9/9/93

Surveyor's License No. 16923

Date: _____

Peer Group Reviewed and Approved
Date: 9-9-93
Kenneth L. Ross
Mason County Surveyor

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1971
REVISED JAN., 1981