

MECOSTA COUNTY REMONUMENTATION PROGRAM

CORNER APPROVED BY PEER GROUP July 22, 1993
MICHIGAN COUNTY OF MECOSTA RECEIVED FOR RECORD

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

'93 DEC -8 P3:59

For corners in

Mecosta
(County)

Located In:

Corner Code #

- | | | | |
|------------------------------------|--------------------------|------------|-------|
| 1. Public Land Survey | T <u>14N</u> R <u>9W</u> | <u>J-9</u> | |
| | T _____ R _____ | _____ | _____ |
| | T _____ R _____ | _____ | _____ |
| | T _____ R _____ | _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ | _____ |
| | S _____ T _____ R _____ | _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ | _____ |
| | S _____ T _____ R _____ | _____ | _____ |

Carl Waldron
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9										●			
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, James G. Knapp, in a field survey on July 6, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therofore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Deputy Surveyor, Abner E. VanNess, set Post in Jan.1838. Corner Post placed 39.50 chains (2607.00 Feet) from N.W. and N.E. corner of Section 26 and Witnessed:

Hemlock 6" West 18 Links (11.88 Feet)
Beech 8" N40°E 11 Links (7.26 Feet)

County Surveyor Record Book No. 1, Page 34, at Register of Deeds Office, show notes by L.W.June County Surveyor in July, 1897 with corner noted as "Bevel Gear for Old Corner", and being 20.60 Chains(1359.60 Feet) from South 1/8 Corner on North and South 1/4 Line Section 23.

(Continued on Back)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1 1/2" x 24" Square Shaft in center of 24" Bevel Gear, buried 3" below road surface at "T" road intersection Centerline 135th. Ave. (18'Gravel) South, and in line with North edge of 8 Mile Road (8'Trail) West and Centerline of (18'Gravel) East.

Corner is 1362.88 Feet from South 1/8 Corner on North and South 1/4 Line, as compared to 1359.60 Feet by L.W.June in 1897.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-9 - 1/4 Corner common to Sections 23 and 26, T14N-R9W.

Found 1 1/2 inch Square Shaft and is accepted as a careful and faithful perpetuation of the position of the original corner.

Removed 1 1/2 inch Square Shaft and 24" Bevel Gear and set in the same position a Standard Mecosta County Remonumentation Monument and a Highway Monument Box, which is buried 8" below road surface.

Set 60p spike and Remonumentation Witness Tag in N.E. side 10" Scotch Pine
Az, 135°, 88.42 Feet (O.B.)

Set 60p spike and Remonumentation Witness Tag in W. side 8" Scotch Pine
Az, 150°, 120.10 Feet

Set 60p spike and Remonumentation Witness Tag in S.E. side 10" Scotch Pine
Az, 225°, 55.52 Feet


Set 60p spike and Remonumentation Witness Tag in S.W. side, 4" Scotch Pine
Az, 296°, 72.67 Feet

Signed by James G. Knapp

Date

Nov

Surveyor's Michigan License No. 25853

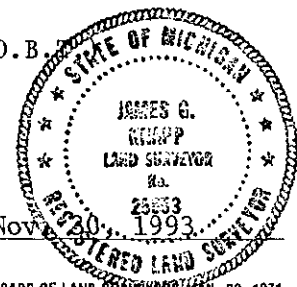

Part A. (Continued from Front Side)

A Certificate of Survey by Gerald J. Gray, P.S. 17741, Recorded in Liber 10, Page 753, on Aug. 14, 1979, notes corner as "Found 2" Solid Bar", and Witnessed:

63.35' S40°W 6" Pine
33.90' N50°W Fence Post
83.84" S45°E 6" Pine

A Land Corner Recordation Certificate by Duane F. Wood, P.S. 24625, Recorded in Liber 2, Page 144 on Sept. 30, 1986, notes corner as "2" Solid Steel Bar", and Witnessed:

6" Pine S40°W 63.35'
F.Post N45°W 36.0'
8" Pine S45°E 88.4'