

MECOSTA COUNTY REMONUMENTATION PROGRAM

CORNER APPROVED BY PEER GROUP ON 6-12-98
 LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in

Mecosta
(County)

Located in: Corner Code #

T	15N	R	9W	1-08
T		R		
T		R		
T		R		
S	T	R		
S	T	R		
S	T	R		
S	T	R		

1. Public Land Survey

2. Property controlling in Section
 3. Miscellaneous Property in Sec.

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

SURVEY &
 REMONUMENTATION

OCT 29 1998

SECTION

STATE OF MICHIGAN
 COUNTY OF MECOSTA
 RECEIVED FOR RECORD

'98 AUG 19 A9:54

Joanna Brown
 REGISTRAR OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, James H. Carter, in a field survey on May 30, 1998 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of court law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of Michigan Board of Land Surveyors or by a decree of a court of law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Only one corner may be recorded on this certificate.

A. Description of original monument and accessories and for subsequent restoration:

- 1837 - JAN, DEPUTY SURVEYOR, A. E. VAN NESS, SET 1/4 POST. BEECH 12" DIAMETER
- 1895 - L. W. JUNE - OLD STAKE (FARM), 24" PINE STUMP - N 15 E - 81 L, 36" PINE STUMP - S 75 W - .101 L.
- 1904 L. W. JUNE - TILE CORNER.
- 1996 - LCRC, L-12, P -121, GERALD GRAY SET IRON IN FIELD - NO AVAILABLE WITNESSES.

APPROVED BY MECOSTA CO. PEER GROUP
 IN ACCORDANCE WITH P.A. 343 of 1990

James H. Knapp
 CHAIRMAN
 DATE JUNE 12, 1998


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND NO TRACE OF MID MICHIGAN IRON IN FARM FIELD THAT IS UNDER AGRICULTURE AT PRESENT TIME. FOUND TILE CORNERS AT GOVERNMENT DISTANCES FOR THE NORTH HALF MILE AND SOUTH HALF MILE OF THIS CORNER. AFTER EXTENSIVE FIELD WORK IN SECTION 22 AND SECTION 23, WHICH WAS DONE IN ORDER THAT DISRUPTION OF ANY PREVIOUS SURVEY AND/ OR OCCUPATION MAY BE PREVENTED. LINE WAS HELD BETWEEN THE TWO JUNE TILES AND DISTANCE WAS HELD TO BEST FIT BOTH OCCUPATION AND MID MICHIGAN SURVEY WORK PREVIOUSLY DONE IN THIS AREA.

SET MECOSTA COUNTY REMONUMENTATION MONUMENT IN A TILIALE FIELD 2 FT BELOW SURFACE.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 1-9 - CORNER COMMON TO SECTIONS 22 AND 23, T15N, R09W.
- SET A STANDARD MECOSTA COUNTY REMONUMENTATION MONUMENT AND IS ACCEPTED AS A FAITHFUL RE-ESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.
- N 27 W - 618.67' - NAIL AND TAG IN CORNER FENCE POST
- N 40 W - 432.54' - NAIL AND TAG IN CORNER FENCE POST
- S 87 E - 693.12' - FACE OF METAL FENCE POST
- N 40 E - 542.02' - NAIL AND TAG IN LINE FENCE POST

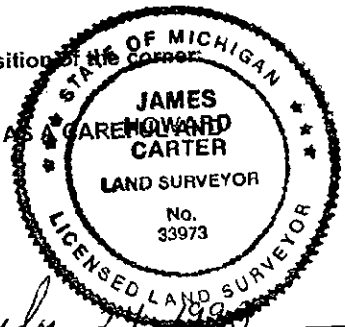

Signed by James H. Carter Date July 27, 1998
 Surveyor's Michigan License No. 33973