

**SURVEY & REMONUMENTATION**  
**MECOSTA COUNTY REMONUMENTATION PROGRAM**

OCT 29 1998

CORNER APPROVED BY PEER GROUP ON OCTOBER 9, 1998

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
 COUNTY OF MECOSTA  
 RECEIVED FOR RECORD

**SECTION**

For corners in

MECOSTA (County)	Located In:	Corner Code #
1. Public Land Survey	T 16N R 08 W	C-07
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

'98 OCT 19 A8:55

*James M. Knapp*  
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, JAMES G. KNAPP, in a field survey on AUGUST 18, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: ONLY ONE CORNER MAY BE RECORDED ON THIS CERTIFICATE.**

**A. Description of original monument and accessories and/or subsequent restoration:**

DEPUTY SURVEYOR, ORSON LYON, SET POST ON NOV. 6, 1847. CORNER POST PLACED 40.00 CHAINS (2640.00 FEET) FROM 1/4 CORNER COMMON TO SECTION 19 AND 20, AND WITNESSED: HEMLOCK 20" N43°E 21 LINKS (13.86 FEET)  
 HEMLOCK 12" N10 1/4° 13 LINKS (8.58 FEET)

ON JULY 16 THRU 18, 1907, L. W. JUNE, COUNTY SURVEYOR, NOTED IN COUNTY SURVEYOR'S RECORD BOOK No. 1, PAGE 153, (FIELD BOOK NO. 8, PAGES 58 - 62), NOTES CORNER AS, "OLD TILE COR."

ROAD SURVEY NOTES AT MECOSTA COUNTY ROAD COMMISSION, BY W. WRIGHT, CIRCA 1935, NOTES CORNER AS "SEC. COR. IRON & TILE".

CERTIFICATE OF SURVEYS AS PER P. A. 132 OF 1970, BY MATTHEW A. McCLUNG, P.S. 13037, RECORDED ON MARCH 19, 1980, IN LIBER 10, PAGE 839, AND NOTES CORNER AS, "FD. 1/2" ROD", AND WITNESSED: POWER POLE S40°E 72.0'  
 24" R. OAK N80°W 80.5'

CORNER RECORDED AS PER P. A. 74 OF 1970, BY MATTHEW A. McCLUNG, P.S. 13037, AS RECORDED ON MARCH 19, 1980, IN LIBER 2, PAGE 10, AND NOTED AS, "FD. 1/2" ROD", AND WITNESSED: POWER POLE S40°E 72.0'  
 24" R. OAK N80°W 80.5'

CERTIFICATE OF SURVEYS AS PER P. A. 132 OF 1970, BY GERALD J. GRAY, P.S. 17741, RECORDED ON SEPT. 25, 1980, IN LIBER 10, PAGE 879, AND NOTES CORNER AS, "FD. 1/2" IRON", AND WITNESSED: S60°E 72.17' POWER POLE  
 S15°E 72.22' 6" PINE  
 N85°W 80.43' 26" OAK

CERTIFICATE OF SURVEYS AS PER P. A. 132 OF 1970, BY JACK E. PIERSON, P.S. 19305, DATE ON MARCH 6, 1983, FILE No. SL-157-83, AND NOTES CORNER AS, "1/2" IRON", AND WITNESSED: 8" S. PINE S27°E 59.29'  
 30" OAK N71°W 80.38'  
 P.P. S60°E 72.20'

**APPROVED BY MECOSTA CO. PEER GROUP  
 IN ACCORDANCE WITH P.A. 345 of 1990**

*James M. Knapp*  
 CHAIRMAN  
 DATE OCT. 9, 1998

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

FOUND 1/2" IRON ROD IN A VITRIFIED CLAY TILE, 15" BELOW GRAVEL ROAD SURFACE, 5' NORTH OF CENTER OF 21 MILE ROAD (24' GRAVEL), AND IN LINE WITH 110<sup>TH</sup>. AVENUE (24' GRAVEL - NORTH) AND FENCE LINE - SOUTH.

FOUND 1/2" RE-BAR AS CALLED FOR ON L.C.R.C. LIBER 2, PAGE 10 AT AZ. 350°, 6.90 FEET (REMOVED DURING ROAD RECONSTRUCTION)

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

C-07, CORNER COMMON TO SECTIONS 17, 18, 19, AND 20, T16N-R08W.

FOUND 1/2" IRON ROD IN A VITRIFIED CLAY TILE, AND IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.


SET A STANDARD MECOSTA COUNTY REMONUMENTATION MONUMENT, INSIDE OF THE VITRIFIED CLAY TILE, AND WITNESSED:

FOUND SPIKE	IN S.E. SIDE 6" WHITE PINE	AZ. 48°,	83.12 FEET
FOUND SPIKE	IN N.E. SIDE UTILITY POLE	AZ. 129°,	65.36 FEET
FOUND SPIKE	IN WEST SIDE 10" SCOTCH PINE	AZ. 158°,	52.58 FEET
SET 60d SPIKE W/REMONUMENTATION WITNESS TAG	IN N.E. SIDE 20" WHITE PINE	AZ. 310°,	63.72 FEET

Signed by James M. Knapp Date OCTOBER 12, 1998

Surveyor's Michigan License No. 25853

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JANUARY 1975

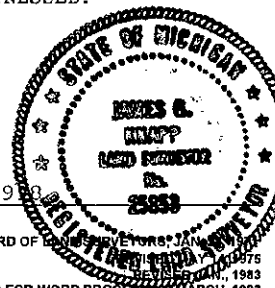

ADAPTED FOR WORD PROCESSING MARCH, 1993