

APPROVED LAND CORNER  
P.A. 345 OF 1990  
MIDLAND COUNTY

277

9/12/96

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>MIDLAND</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>13N</u> R <u>1W</u>	<u>1-11</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

STATE OF MICHIGAN  
MIDLAND COUNTY  
REMONUMENTATION & FILED

27 NOV 96 2:52 P.M.

BEVERLY J THAYER  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, PAUL B. LAPHAM, in a field survey on NOVEMBER 19 95 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

1852 BURT  
SET POST  
WIT.-LYNN 16" N55 1/2W 29 LKS.  
ELM 28" S60E 41 LKS.

4-16-02 C.S.R.  
POST WITH STONE AROUND.  
40.08 TO I-12, 40.18 TO H-11

9-24-01 GIBBS, C.S.R.  
POST, STONE AROUND  
40.16 TO I-10, 40.18 TO H-11

4-18-02 GIBBS,  
POST WITH STONE AROUND.  
40.08 TO I-12, 40.12 TO J-11,  
80.16 TO I-13

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 3/4"x36" IRON AND CLAY TILE IN MON. BOX 4' SOUTH OF CENTER OF ASPHALT PAVEMENT.  
MEAS. SOUTH 5287.99' (GIBBS 5290.56') TO I-13 (I-12 FALLS ON A BRIDGE). MEAS. WEST 2656.28'  
(GIBBS 2651.88") TO H-11. MEAS. NORTH 2649.75' (GIBBS 2650.56') TO I-10 MEAS. EAST 1330.96'  
(GIBBS 1323.96') TO OCCUPIED 1/8 LINE.


Corner, I-11 was approved for remonumentation at a Peer Review Committee Meeting on SEP. 12, 1996

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET 3/4"x18" GAS PIPE WITH BRASS CAP STAMPED "MIDLAND CO. REMON. COR. P.S. 9433" IN MONUMENT BOX PER C.S.R. SURVEY.  
ACCEPTED AS BEST AVAILABLE EVIDENCE OF THE ACCEPTED POSITION OF THE CORNER.

WITNESSES:

S45°W, 43.57' - CENTER TELE. RISER  
N45°W, 55.75' - NAIL & TAG IN POWER POLE  
N10°W, 49.00' - NORTH END OF "L" SHAPED 12" C.M.P.  
N60°W, 48.31' - WEST END OF "L" SHAPED 12" C.M.P.

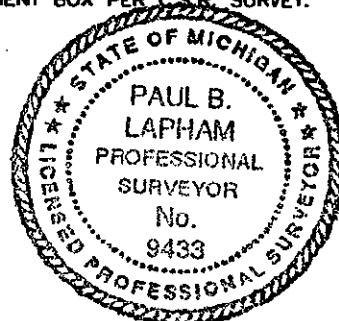

Signed by Paul B. Lapham  
Surveyor's Michigan License No. 9433

Date 10-4-96